State of California

Memorandum

To:

Gary M. Carlton, Executive Officer California Regional Water Quality Control Board Central Valley Region 3443 Routier Road

Sacramento, California 95827-3098

Date: December 31, 1997

From:

Department of Pesticide Regulation - 1020 N Street, Room 100

Sacramento, California 95814-5624

Subject: RICE PESTICIDES PROGRAM REVIEW

Pursuant to the Rice Pesticides Program being conducted under a triennial review process, my staff prepared the attached annual report containing a review of the 1997 rice season and a proposal for the Rice Pesticides Program for the next triennial period spanning the years 1998-2000.

This memorandum will provide overviews of the 1997 rice production season and the cumulative three-year Rice Pesticides Program spanning 1995-1997.

The goal of the three-year program is to meet performance goals for the rice pesticides established in the Basin Plan of the Regional Water Quality Control Board Central Valley Region (Board) to protect water quality and prevent aquatic toxicity. The five pesticides are the herbicides molinate and thiobencarb, and the insecticides carbofuran, methyl parathion, and malathion. The most significant points of this review for 1997 are:

- Rice acreage decreased slightly (less than one percent) from 1996; use of the herbicide thiobencarb increased 63 percent from 1996, while use of molinate, carbofuran, and methyl parathion decreased 13, 11, and 35 percent, respectively.
- Water-holding requirements used to facilitate dissipation of rice pesticides on the site of application appear to be adequate for meeting performance goals.



Princed on Recycled Paper

- Concentrations of molinate and thiobencarb exceeded performance goals in the agricultural drains in a close proximity to rice fields for one to two weeks during the peak of the application season. Concentrations of carbofuran barely exceeded the performance goal from late April through late May in one agricultural drain, and on two dates in early May in the other agricultural drain.
- Water collected periodically from the Colusa Basin Drain in April, May, and June was not acutely toxic to aquatic invertebrates.
- The most significant sources of rice pesticides in surface water appear to be aerial drift and seepage beyond the field perimeter.
- Only four variances on water-holding requirements (emergency releases)
 were approved and these releases could not have had an impact on
 pesticide concentrations at the monitoring sites due to their geographic
 locations.
- Compliance with management practices for minimizing spillage of rice pesticides into surface water was excellent.

The rice pesticide program has remained essentially unchanged for the last three years due to the overall success in meeting performance goals through the water-holding periods required when restricted materials are used. Some seasonal exceedences of performance goals have occurred and are attributable to sources other than discharge after the holding periods. The following highlights observations and trends observed over the last three years:

- Overall, estimates of rice acreage harvested ranged from 465,000 acres (1995) to 517,000 acres (1996). Rice acreage is thought to be at the highest levels possible in the Sacramento Valley in 1996.
- Water-holding requirements used to facilitate dissipation of rice pesticides on the site of application appear to be adequate for meeting performance goals.

Gary M. Carlton December 31, 1997 Page 3

- Rice pesticide concentrations in the Sacramento River were not detected above levels the laboratories could quantify for thiobencarb, carbofuran, methyl parathion and malathion; molinate concentrations were low (below 2 parts per billion).
- Early season concentrations (prior to the end of the required water-holding periods) of molinate, thiobencarb and carbofuran in the agricultural drains have exceeded the performance goals each year. Methyl parathion concentrations exceeded the performance goal in one agricultural drain in 1995 and malathion concentrations exceeded the performance goal in two agricultural drains in 1995 and one in 1996. Analyses of the pesticide use data suggests the most significant sources of rice pesticides in surface water prior to the end of the required water holds appear to be aerial drift, seepage beyond field perimeters and during some years, emergency releases.
- Variances on water-holding requirements (early or emergency releases) were largely limited to unusual weather events that overwhelm water-holding capacities. (Unseasonable mid-May rains and subsequent winds resulted in many variances in 1996.)
- Compliance with defined management practices for minimizing spillage of rice pesticides into surface water was excellent.
- Programmatic adjustments to shorten the water-holding periods for growers discharging into multi-grower recirculating systems are not needed. A study conducted by Department of Pesticide Regulation (DPR) showed toxicity to aquatic invertebrates existing in water collected at the point of discharge from fields within closed recirculating systems was quickly rendered nontoxic downstream within the closed system.

Gary M. Carlton December 31, 1997 Page 4

The rice pesticide program for 1998-2000 has the same basic framework as the 1995-1997 program, with one addition and the following highlights:

- Variances on water-holding requirements will be granted in limited cases where documented saline conditions exist on the field at levels shown to produce economic damage to rice. These variances will be protective of established water quality objectives.
- Management practices for containing seepage, and the pesticides it may carry, will be addressed through education and implemented through voluntary efforts. DPR together with the University of California Cooperative Extension produced an informational brochure on seepage identification and mitigation that will be ready to distribute during the 1998 season. DPR will continue to work with other agencies to better educate growers on the seepage problem and, where possible, to quantify effects of seepage on water quality.
- Drift control measures will focus on educating the rice-growing community about the potential problems associated with aerial applications to properties near agricultural drainage canals and deposition to sweat ditches (small drainage ditches used to channel seepage water away from a field's perimeter). DPR is revising the regulations pertaining to drift to address all aerial applications as a step towards mitigating this off-site movement of pesticides. In addition, DPR staff have been reviewing data produced by the Spray Drift Task Force on the sources of variability in spray drift.

A study on toxicity monitoring in recirculating systems conducted by DPR in 1995 was described in the 1995 Report on the Rice Pesticide Program. Our final interpretation of the data from this study is that the potentially toxic discharges of field water into a multigrower water management system were immediately rendered nontoxic upon joining other waters of the closed system.

Gary M. Carlton December 31, 1997 Page 5

There is no evidence to suggest that the current holding times for growers discharging into a closed system result in toxicity within the closed system. Thus, the holding times required within closed systems will remain unchanged.

My staff will continue to work closely with your staff providing updates on rice pesticide monitoring results, updates on registration actions that may affect pesticide use in rice or potential discharges, opportunities to meet with an ad hoc advisory group to evaluate and plan guidelines for rice pesticide management, and summary information addressing rice pesticide use and water quality by the end of each year.

I recommend the Board approve the proposed Rice Pesticides Program for 1998-2000. The Rice Pesticides Program remains a model of how our agencies can cooperate to reach our common goal of protecting water quality.

If you have any questions, please contact me, or your staff may contact Nan Gorder, at (916) 324-4265, or Marshall Lee, at (916) 324-4269.

James W. Wells

famer W. Wells

Director

(916) 445-4000

Attachment

cc: Nan Gorder
Marshall Lee

Department of Pesticide Regulation Information on Rice Pesticides Submitted to the Central Valley Regional Water Quality Control Board December 23, 1997

Programs have been implemented by the Department of Pesticide Regulation (DPR) since 1983 to reduce discharges of the rice herbicides molinate (Ordram®) and thiobencarb (Bolero®and Abolish®) into surface waterways. In 1990, the objectives of these control efforts were clarified and expanded, following the adoption of amendments to the Central Valley Regional Water Quality Control Board's (Regional Board) Water Quality Control Plan (Basin Plan). This plan established performance goals for molinate and thiobencarb beginning in 1990, and for the insecticides carbofuran (Furadan®), methyl parathion, and malathion beginning in 1991. Regional Board staff are currently in the process of amending the pesticide section of the Basin Plan. This Basin Plan amendment will include defining numeric water quality objectives for the rice pesticides addressed in this program.

The following review describes the factors affecting quantities of molinate, thiobencarb, carbofuran, methyl parathion, and malathion discharged to agricultural drains and the Sacramento River and efforts to meet the performance goals in 1997. A summary of pertinent water quality monitoring efforts is provided. Programs implemented in 1997 helped control discharges of molinate, thiobencarb, carbofuran, methyl parathion, and malathion from rice fields to comply with the performance goals and the water quality objective for toxicity in the Basin Plan.

REVIEW OF 1997 PROGRAM

Discussion

A summary of the 1997 Rice Pesticides Program can be found in the following sections. Program requirements were implemented by county agricultural commissioners using restricted material permits. A description of the 1997 rice pesticide program requirements can be found in the guidelines provided to the county agricultural commissioners by the Director of DPR in a memorandum dated March 8, 1995 (see Appendix A). The 1995 permit conditions were determined appropriate for use in 1997. The commissioners also provided information to growers on the voluntary malathion program. Additional efforts were taken by DPR staff to continue improved communication about the seepage and drift problems to the rice industry. Aspects of the 1995-7 program that were different from the 1994 program are summarized in Appendix B.

Molinate

The standard molinate holding period remained 28 days in the Sacramento Valley. Shorter holding periods were available for molinate users in specific areas (closed water management systems, water-short areas, in hydrologically isolated fields throughout the rice-growing region, and in the San Joaquin Valley).

Thiobencarb

The standard Bolero holding period remained 30 days in the Sacramento Valley, while the standard Abolish hold was 19 days. Shorter holding periods were available for thiobencarb users in specific areas (closed water management systems, water-short areas, in hydrologically isolated fields throughout the rice-growing region, and in the San Joaquin Valley).

Carbofuran, Methyl parathion, and Malathion

The programs for the insecticides retained the basic strategies of the programs used in 1995, with standard required holds of 28 days for carbofuran-treated fields and 24-day holds for methyl parathion-treated fields. Shorter holding periods were available for carbofuran users within closed water management systems. Malathion is not a restricted material; there are no requirements that treated field water be held on site. Malathion users are encouraged to voluntarily hold malathion-treated water for 4 days.

Seepage Control

Users of rice pesticides were required to prevent seepage of field water through the field's weir box, generally by securing the box with plastic and with soil to a depth higher than the water level.

Additionally in 1997 as in 1995 and 1996, the county agricultural commissioners' offices were supplied with several handouts providing guidance to growers on voluntary seepage prevention measures (see Appendix C). The single page handout was prepared by DPR and numerous interested parties representing the industry, the University of California, the agricultural commissioners, and the United States Department of Agriculture. The handout entitled: Closed Rice Water Management Systems was prepared by the United States Department of Agriculture with the University of California Cooperative Extension. This information was distributed to growers at the time of permit issuance.

Use of Selected Pesticides in 1997

In rice-growing counties of the Sacramento Valley, county agricultural commissioners record the acreage treated with molinate, thiobencarb, carbofuran, and methyl parathion

when Notices-of-Application are submitted by the grower to each county office. Based on these records, and on pesticide use reports where available, it was estimated that 308,584 acres were treated with molinate, 224,042 with thiobencarb, 138,175 with carbofuran, and 13,261 with methyl parathion (Table 1). These estimates indicate that molinate use decreased approximately 13.37 percent from use in 1996; thiobencarb use increased 62.97 percent; carbofuran use decreased 10.53 percent; and methyl parathion use decreased 35.29 percent. Pesticide use report data for two other important rice pesticides, malathion and bensulfuron methyl (Londax®), are not available yet.

Propanil use has been severely restricted in the Sacramento Valley by regulation since 1986 to prevent potential damage to nearby susceptible crops (especially prunes). Use was allowed only in limited areas of Glenn and Colusa counties and south of Sankey Road in Colusa county with a cap on total daily applications (500 acres) and a limit to total seasonal use (10,000 acres). With the rapid development of widespread resistance to Londax in the broadleaf and sedge weed populations, alternative chemical tools were desperately needed in 1997. A new formulation of propanil was available and was believed to have a low propensity to move off the site of application. Emergency regulations were promulgated to allow expanded use of the new formulation of propanil by ground application (valley-wide use allowed with 3 mile buffer zones from susceptible crops) and to allow aerial applications in special study regions of Butte and Placer counties. Use data is not yet available.

Rice blast, a potentially devastating fungal disease of rice, was first discovered in California in 1996. The incidence of this multi-cyclic disease increased dramatically between 1996 and 1997 (from approximately 13,000 to approximately 50,000 acres infected, respectively). No fungicides were registered in California to control this disease. Azoxystrobin (Quadris®) was granted a Section 18 crisis emergency registration to combat this disease. Use data is not yet available.

About 513,000 acres of rice are forecasted to be harvested in California in 1997, a decrease of about 0.78 percent from the 1996 crop.

Enforcement Activities

The county agricultural commissioners are responsible for enforcement of the rice pesticide programs. The role of the commissioners and their staffs includes explaining the program to growers, pest control advisers and operators; issuing restricted material permits; conducting use monitoring inspections; evaluating emergency release variances; and providing DPR with information on the use of pesticides.

Before any material on the list of California restricted materials may be applied, growers must obtain a permit from their county agricultural commissioner. The permits may specify conditions for use of the material, including post-application water-holding

requirements. A Notice-of-Intent must be filed with the county agricultural commissioner 24 hours prior to the application, providing the commissioners with the option to observe the mixing, loading, and application of the material, thus enforcing regulations that pertain to pest control operations. Molinate, thiobencarb, carbofuran, and methyl parathion are currently California restricted materials; malathion is not. Permits which specify post-application water-holding requirements, like those for the use of molinate, thiobencarb, carbofuran, and methyl parathion, also require that the Notice-Of-Application (NOA) be filed with the county agricultural commissioners within 24 hours after the application. NOAs are used to determine when holding periods begin.

In 1996 DPR and the county agricultural commissioners implemented a Prioritization Plan and a Negotiated Workplan. Part of this plan was a negotiated number of waterhold inspections. These plans allow the counties to set priorities within standard guidelines. Rice pesticide applications and water-hold inspections are ranked as "High Priority" inspections as the rice pesticides are restricted materials, and several rice pesticides are under special study by DPR. The county offices then receive partial reimbursement from DPR based on numbers of inspections completed.

Staff of county agricultural commissioners' offices and DPR's Pesticide Enforcement Branch inspected 3,101 rice fields for compliance with water-holding requirements. Four growers were cited for holding violations. None of the four violations were a result of intentional release of water. Additionally there were 185 inspections of the pesticide mixing and loading process with one in non-compliance and 314 inspections of pesticide applications with five in non-compliance. Only five of the total violations were serious enough to warrant agricultural civil penalty actions. None of the violators were cited in previous years.

The county agricultural commissioners no longer grant variances on the holding requirements for fields treated with molinate if the length of the holding time is adversely affecting the rice plants. In 1997, emergency releases were limited to fields where an 11-day molinate hold had elapsed and circumstances beyond a conscientious grower's control led to the need to release water. Growers granted such variances were instructed to drain water only to the extent necessary to restore a healthy growing environment for the rice seedlings. In 1997, two emergency releases were granted (affecting 420 molinate-treated acres; Appendix G) and two were denied by commissioners' office staff. Table 2 presents information on emergency releases from molinate-treated fields from 1987 through 1997.

Beginning in 1994, repeat and multiple violators were required, as part of special permit conditions, to make improvements in their water management capabilities. Such improvements may include installation of pumps for tailwater recirculation or leaving land fallow to contain spillage. Growers who violate water holding requirements are subject to maximum penalties within DPR's Enforcement Guidelines. However, conditions preceding violations (e.g., unfavorable field conditions that could not be moderated by the growers' best efforts) may be considered when assessing penalties.

COOPERATIVE WATER QUALITY MONITORING PROGRAM

The California Rice Industry Association retained the consulting firm Kleinfelder, Inc., to collect water monitoring samples from the Colusa Basin Drain at Highway 20 (CBD5) in Colusa County, Butte Slough at Lower Pass Road in Sutter County, and from a site on the Sacramento River at the Village Marina (see Figure 1). The sampling methods and chemical analyses of the water samples from all three sites were conducted in the same manner. The monitoring protocol is in Appendix D.

Summaries of the monitoring activities addressing molinate, thiobencarb, carbofuran, methyl parathion, and malathion in Sacramento Valley waterways in 1997 are presented below.

Sampling and Analytical Regimen

Samples were collected from all three sample sites from mid-April through late June. Samples were collected from CBD5 twice weekly. Samples were collected from Butte Slough and the Sacramento River near the Village Marina weekly during the first and last two weeks of this period, and twice weekly during the middle six weeks.

Samples were delivered to Zeneca Ag Products, manufacturer of Ordram, for molinate analyses. Samples were delivered to Valent, the primary distributor of products containing thiobencarb, for analyses. Samples were delivered to FMC Corporation, manufacturer of Furadan, for carbofuran analyses and to the California Department of Food and Agriculture (CDFA) laboratory for methyl parathion and malathion analyses. Additional samples representing over half of the total samples collected at CBD5 and analyzed by the primary laboratories were analyzed as quality control samples. Molinate, thiobencarb, and carbofuran concentrations in the quality control samples were determined by the CDFA laboratory, and methyl parathion and malathion by Alta Laboratories. Additional samples were collected and stored for analyses in cases where confirmations of analytical results might have been required. Blind spikes were periodically submitted for analyses with field samples.

The City of Sacramento analyzed molinate and thiobencarb concentrations in water samples collected from the Sacramento River at the intake to its water treatment plant. Samples were collected on May 15 and twice weekly from May 19 through June 13, with an additional sample collected the first week of June.

Toxicity Testing

Water samples were collected from the Colusa Basin Drain at CBD5 weekly from April 22 through June 3. Department of Fish and Game staff exposed neonate (<24 hours old) cladocerans (*Ceriodaphnia dubia*) to sample water for 96 hours, as well as to control and blind spiked water samples. Percent survival was recorded.

Results of the 1997 Monitoring Program

Results of the monitoring program are found by monitoring site in Tables 3, 4, and 5. Results from the monitoring conducted by the City of Sacramento at the intake to the water treatment facility are found in Table 6.

Molinate

The highest concentration of molinate detected in these waterways in 1997 was 25.67 parts per billion (ppb) at CBD5 on May 22, as reported by Zeneca. These data indicate the performance goal for molinate (10 ppb) was exceeded in the Colusa Basin Drain for a five week period and in the Butte Slough for three weeks, but not in the Sacramento River. Table 7 presents the peak concentrations of molinate in the Sacramento Valley waterways in each year since 1980.

Molinate was detected in the Sacramento River at the Village Marina in Sacramento County on four dates from May 20 through May 29, with a peak concentration of 1.72 ppb. The City of Sacramento detected concentrations of molinate in the Sacramento River at the intake to its water treatment facility on ten days from May 15 through June 11 with a peak concentration of 1.3 ppb (Table 6). A peak of 1.7 ppb was found there in 1993. The maximum contaminant level for molinate, established to protect public health, is 20 ppb.

Thiobencarb

Analytical results reported by Valent indicated thiobencarb concentrations in the agricultural drains were highest in CBD5, where they peaked at 12.3 ppb on May 20 (Table 3). Based on these results, the thiobencarb performance goal (1.5 ppb) was exceeded on eleven out of twelve sampling dates from May 6 through June 12 in the Colusa Basin Drain, and on the three sampling dates from May 22 through May 29 in Butte Slough (Table 4). Thiobencarb was not detected in the Sacramento River at the Village Marina (Table 5). The City of Sacramento did not detect thiobencarb above 0.10 ppb (the level above which concentrations can be quantified) at the drinking water intake (Table 6, respectively). Table 8 presents the peak concentrations of thiobencarb in Sacramento Valley waterways in each year since 1980.

Carbofuran

Results of carbofuran analyses performed by FMC are presented in Tables 3, 4, and 5. The performance goal for carbofuran (0.4 ppb) was exceeded in the Colusa Basin Drain at CBD5 on four dates between April 22 and May 22, with a peak concentration of 0.62

ppb. The performance goal was also exceeded in Butte Slough on May 6 and 8, with a peak concentration of 0.59 ppb. No carbofuran was detected in the Sacramento River.

Methyl parathion

Results of methyl parathion analyses performed by CDFA indicated that methyl parathion was detected at the CBD5 and Butte Slough sites, with a peak concentration of 0.107 ppb on May 13. The methyl parathion performance goal (0.13 ppb) was not exceeded in 1997 (Tables 3, 4, and 5).

Malathion

Analytical results performed by CDFA indicated that malathion was detected only once at the Butte Slough site at a concentration less than the performance goal of 0.1 ppb (Table 4).

Toxicity Testing

DFG staff did not observe significant toxicity in water samples collected during 1997 (see Appendix E). This is not surprising as pesticide concentrations did not exceed the *Ceriodaphnia dubia* LC_{50} values.

Quality Assurance Program

Based on the methods used, all laboratories performed well on internal quality assurance and when provided with blind-spike samples. The detailed Quality Assurance Program is in Appendix F.

Discussion of Monitoring Results

Mass Transport of Pesticides in Agricultural Drains and the Sacramento River

Estimates of the total mass of pesticides transported in the Sacramento River may be used to compare pesticide loading in different years. However, mass transport cannot be used to determine compliance with performance goals. The flow data only recently became available, thus mass transport has yet to be calculated.

Weather and Its Influence on Water Quality

Weather conditions, especially those during and after applications of rice pesticides, influence the performance of water quality control programs. Dissipation rates of many pesticides, e.g., molinate, increase with increasing temperature, so warm weather during water holding periods helps reduce concentrations. Warm weather in May of 1987 and 1992 helped explain why concentrations in waterways and mass transport in the

Sacramento River were relatively low in those years. Conversely, in May 1990 and in late May and early June 1993, cool and rainy conditions prevailed, and the results of the molinate program were not as successful. Thus, it is important to be aware of weather patterns when reviewing monitoring data.

The 1993 weather pattern was not conducive to pesticide dissipation and the large number of emergency variances on water management requirements resulted in unusually high pesticide loading in the agricultural drains and the Sacramento River. Likewise, the 1995 season was unusually cool and wet, and not conducive to pesticide dissipation. The 1996 season was notably wet, aggravating the massive weed problems. Late rains in mid-May in 1996, followed by over a week of strong winds, resulted in difficulties in holding water for many growers.

The 1997 season was ideal for rice production, despite the devastating winter rains. In general, the warm spring provided time for cleanup and preparation of the fields in time for an early start to planting.

Flows in Agricultural Drainage Canals and the Sacramento River

Freshwater flows dilute pesticide-laden water that may enter surface waterways but flows in the Colusa Basin Drain remain low through water conservation efforts within the watershed of the Drain. The control gates were closed at Knight's Landing from June 17 through 30, eliminating flows from the Colusa Basin Drain to the Sacramento River during that time.

Sources of Pesticides in 1997

Pesticides used in rice culture may enter surface water from five sources under normal conditions. Drift during aerial applications and transport through levees with seepage water can be expected to contribute to loading during and shortly after the application period. Discharges from fields prior to the end of the legal holding times (i.e., illegal releases and emergency releases) are most prevalent two to four weeks following application. Legal releases are the predominant source of loading after the water holding requirements lapse. By examining the occurrence of rice pesticides in surface water in relation to their application schedules (Figures 2-6), presumptions can be made regarding the effects of each potential source.

Aerial Drift

The 1996 rice pesticide program had specific provisions for reducing the effects of aerial drift on water quality, described above. Evidence suggests that aerial drift may continue to account, in part, for peak concentrations of all the rice chemicals in the Colusa Basin Drain. When peak concentrations occur early in the season, and at irregular intervals, the

source is likely drift at the time of application. In 1997, no dilution of pesticides in the agricultural drains occurred during May or June as there was no rain during that period.

Drift cannot be addressed with management practices that help control discharges. Spray drift is an on-going issue for DPR. The Environmental Monitoring and Pest Management Branch continues to work with the Enforcement Branch and county agricultural commissioners to educate the rice industry and seek solutions to this problem. Pesticide registrants formed a Spray Drift Task Force to identify the key factors controlling drift. The Spray Drift Task Force has conducted numerous studies and has provided that data to the United States Environmental Protection Agency as well as to DPR. Regulatory management of aerial drift is being sought that, although generic in nature, will be applied to the Rice Pesticides Program in the future.

Seepage

In some rice fields, field water can move laterally through levees and beyond the perimeter of the field. Often levee borrow pits are used as a conveyance for this water (in this case known as "sweat ditches") and, when seepage flows are high enough, discharge the water into local drainage canals. Molinate, apparently transported with this seepage, has been detected in water in sweat ditches at concentrations as high as 840 ppb, even after the ditches were tarped to eliminate influences of aerial drift (Pino 1992). Staff of the Regional Board sampled four sweat ditches in 1994, although in this survey the ditches were not tarped. Molinate was detected in each ditch at concentrations ranging from 44 to 1300 ppb; carbofuran, from 0.4 to 11 ppb. At one of the sites, molinate granules were visible on both sides of the sweat ditch, apparently the result of an inaccurate aerial application. Such aerial deposition of pesticides to sweat ditches is another means of transporting pesticides offsite into surface waterways.

The seasonal changes in molinate concentrations at CBD5 are more characteristic of sustained inputs like seepage than of the effects of incidental aerial drift, as was seen with methyl parathion and thiobencarb. Concentrations rose shortly after the application season began; this was well before the end of the required holding periods from rice fields.

Language for a survey to quantify grower efforts to contain seepage has been drafted. This survey might have been conducted with the United States Department of Agriculture Natural Resources Conservation Service, but the survey it was to be combined with is not likely to be distributed. DPR will continue to explore other opportunities for surveying growers on this issue.

DPR together with the University of California Cooperative Extension Service prepared an informational brochure providing the basis for the concern about seepage, and a list of efforts growers might take to help to contain seepage water. This new brochure is currently in the final review stages and will be available for distribution to growers for the 1998 season.

Emergency and Early Releases

Four variances in water holding requirements were granted in 1997 suggesting growers planned carefully for unusual weather patterns. The total area affected was 535 acres. The water discharged from these acres could not have contributed to concentrations detected in surface waterways due to the geographic location of the fields, or because the water was held on fallow land. Paperwork filed for these emergency releases can be found in Appendix G.

Illegal Releases

County agricultural commissioner offices inspected 3,101 acres for water-holding compliance and cited only four growers for holding violations. These violations were not the result of intentional release of water. Illegal releases are believed to be minimal.

Legal Releases

Evidence suggests that the length of the holding times in the Sacramento Valley is generally adequate to meet performance goals. After June 10, the approximate date on which the early post-application discharges may resume from treated fields, the presence of pesticides in regional waterways appears to be on the decline and not characteristic of the sustained contamination expected from inadequate holding requirements. In most cases, performance goals during this period were not exceeded for more than two consecutive sampling dates, indicative of sources of contamination that are transitory, such as aerial drift from late season applications or emergency and illegal releases, combined with discharges.

Additional Information on Thiobencarb

In 1994, the limitations on the sales of thiobencarb products were removed. Programmatic changes such as berming drainage structures and shorter required holding periods for fields treated with Abolish were thought to be helpful in improving water quality overall and precluded the need for a sales limitation. (Abolish, the liquid formulation of thiobencarb is shown to have a lower potential for off-site movement than Bolero, the granular formulation.)

United Agricultural Products (UAP), distributors of Abolish, submitted data regarding the use of Abolish on fields utilizing the "pin-point flood" method of water management. Such fields are flooded, then drained or allowed to dry soon after seeding to help promote root growth in the seedling. Abolish is then aerially applied and the field is reflooded. UAP's data show that thiobencarb concentrations are initially higher in field water treated

in this manner, compared to fields treated with the "preflood surface" method (Heier and Sakamoto 1994). However, field concentrations appear to decline quickly so that by nineteen days, the last day of the Abolish holding time in most situations, concentrations are about the same as those in fields treated using the "preflood surface" method. It was demonstrated earlier (Valent 1993) that the potential for thiobencarb to be discharged from a field treated with Abolish using the preflood surface method was much lower than from a field treated with Bolero.

Preliminary use data indicate thiobencarb use increased dramatically in 1995 (up 47 percent over 1994), in 1996 (up 29 percent over 1995), and in 1997 (up 87 percent over 1996). This increase can be partially attributed to the usefulness of thiobencarb as a resistance management tool for weed resistance against Londax. The very long water holding periods coupled with grower concerns over the stringent emergency release provisions have resulted in growers turning to alternative production practices, such as the pin-point flood method that provides more flexibility for water holds early in the season. Aerial applications of Abolish lend themselves to use during the practice of the pin-point flood method.

Thiobencarb concentrations in the agricultural drains in 1996 and 1997 were higher for longer periods than in recent years, yet the water quality objective for toxicity and the additive toxicity levels were fully protected. Although thiobencarb use could rise further, holding periods, if they are properly implemented, will likely remain adequate for meeting the performance goals. The potential concentrations due to drift are not likely to be in excess of the toxicity objectives. DPR staff are conducting further analyses to evaluate trends in Abolish versus Bolero use.

PROPOSED PROGRAM FOR 1998-2000

Program Descriptions

The program description proposed for the years 1998-2000 will differ in only one respect from that described in the memorandum to the agricultural commissioners in Appendix A. Limited provisions for emergency release of water will be added for fields where rice is strained by highly saline conditions. (Water quality objectives will be met under these emergency provisions.) The rice pesticides program will continue to use restricted material permits and associated conditions to implement water management practices that reduce pesticide discharges into surface waters. In addition, management of other important sources of contamination will continue to be addressed. These practices, when fully implemented, are expected to result in attainment of water quality objectives and protect performance goals.

Discussion

Water Holding Requirements

The water holding requirements in the Sacramento Valley in 1995-1997 were adequate to meet performance goals and will not be adjusted in the 1998-2000 program. These holding requirements will continue to prevent acutely toxic discharges as well. To prevent acutely toxic discharges of pesticides in the southern Sacramento and San Joaquin Valleys, water holding requirements for most users of molinate and thiobencarb were increased in 1995 and will not change in the 1998-2000 program. In addition, water holding times will not be increased in multi-grower closed systems. Rice growers in one of the several hydrologically-isolated areas may request the county agricultural commissioner to evaluate, on a case-by-case basis, the characteristics of the local drainage system to determine whether discharged water flows into perennial streams.

Drift Control

Drift control provisions will be as they were in 1995-1997, and special attention will be given to prevent aerial deposition to sweat ditches during application. DPR is revising the regulations pertaining to drift to address all aerial applications.

Seepage

Seepage appears to make contributions to the pesticide load in local drainage canals. Molinate and carbofuran have been detected in sweat ditches at concentrations high enough to exceed levels reported as acutely toxic to aquatic invertebrates by Harrington (1990) and Menconi and Gray (1992). Management practices can help minimize these contributions and will be promoted as means to minimize pesticide movement with seepage.

DPR worked with the University of California Cooperative Extension to develop an informational brochure entitled: Seepage Water Mangament, Voluntary Guidelines for Good Stewardship in Rice Production. This brochure describes the potential adverse effects of discharged seepage, provides guidance in recognizing seepage, and suggests practices growers might implement to minimize the impacts of seepage. This brochure will be available to be distributed to growers for the 1998 season.

DPR, along with county agricultural commissioners and others, will continue their efforts to identify areas where seepage contributes to local water quality problems and where possible, will track voluntary efforts taken by growers to contain or reuse seepage water.

Emergency/Early Releases

Emergency release provisions will be expanded in a limited fashion to include fields with documented saline conditions that would result in economic damage to the rice if the saline water was left on the field. The provisions will be protective of the narrative water quality objective for toxicity. The detailed proposed provisions for these emergency releases are in Appendix A, Attachment 1, pages 3-4 (molinate provisions); and Appendix A, Attachment 2, pages 5-6 (thiobencarb provisions).

Education

As was the case in 1995-1997, DPR staff will use opportunities to educate growers, pest control advisors, and applicators on the unique problems of rice pesticides and surface water contamination.

Enforcement

County agricultural commissioners will continue the enforcement program outlined above.

Monitoring

DPR will continue to assume the responsibility of planning and implementing the monitoring program. Procedures for sampling and coordinating sample delivery to analytical laboratories will continue in a manner similar to 1997. The California Rice Industry will again support this program through retention of a consultant to collect the water samples.

REFERENCES

Harrington, J.M. 1990. Hazard assessment of the rice herbicides molinate and thiobencarb to aquatic organisms in the Sacramento River system. Calif. Dep. of Fish and Game, Environ. Services Div., Admin. Rep. 90-1, Rancho Cordova.

Heier, J.L. and S.S. Sakamoto. 1994. Rice field tailwater monitoring utilizing pin point flood cultural practice. United Agricultural Products.

Huang, C. 1996. Memorandum to Brian Finlayson, Department of Fish and Game: Aquatic toxicology laboratory report, results of examination (Oct. 1, 1996). Calif. Dep. of Fish and Game, Pesticide Investigations Unit, Elk Grove.

Menconi, M. and S. Gray. 1992. Hazard assessment of the insecticide carbofuran to aquatic organisms in the Sacramento River system. Calif. Dep. of Fish and Game, Environ. Services Div., Admin. Rep. 92-3, Rancho Cordova.

Schnagl, R. and W. Wyels. 1993. Memorandum to Marshall Lee, Department of Pesticide Regulation: Molinate concentration in rice field discharges, 1993 (Aug. 6, 1993). Calif. Regional Water Qual. Control Board, Central Valley Region, Sacramento.

Valent. 1993. Abolish 8EC rice herbicide: proposal for inclusion into the 1993 rice pesticide control program (Feb. 10, 1993). Valent U.S.A. Corporation, Walnut Creek.

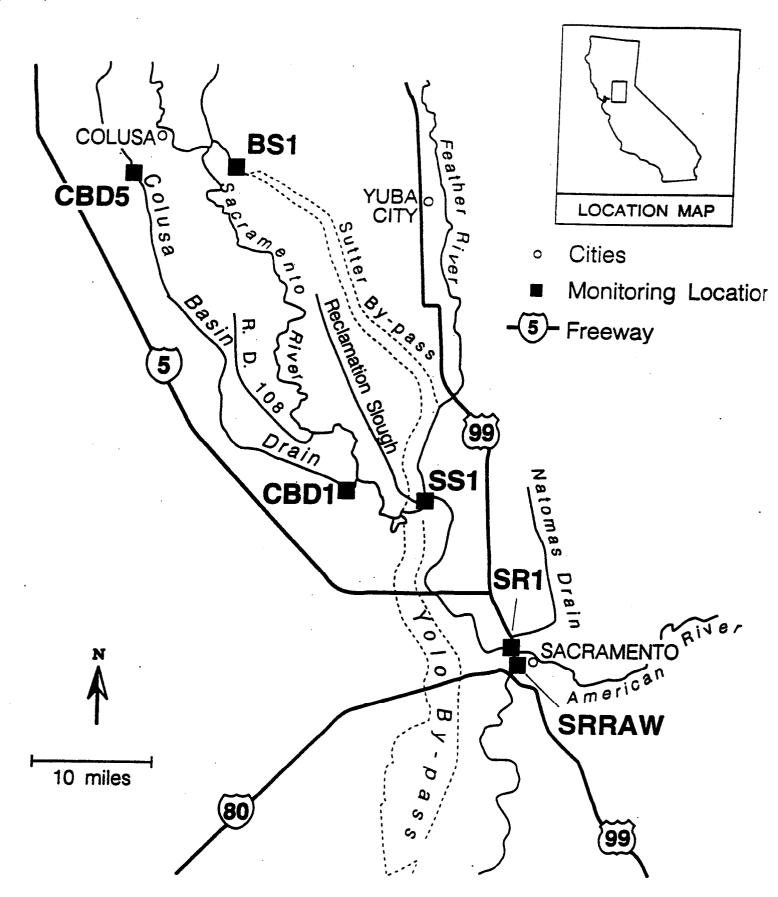


Figure 1. Pesticide monitoring sites in the Sacramento Valley. (Key to monitoring sites on next page.)

Monitoring sites in the Sacramento Valley

CBD5	Colusa Basin Drain near Highway 20 in Colusa County.
CBD1	Colusa Basin Drain at Roads 109 and 99E near Knight's Landing in Yolo County, near its outfall on the Sacramento River.
BS1	Butte Slough near Highway 20 in Sutter County.
SS1	Sacramento Slough at the Department of Water Resources gauge station in Sutter County, near its outfall on the Sacramento River.
SR1	Sacramento River approximately 1.5 km upstream from the confluence with American River, at the Village Marina in Sacramento County.
SRRAW	Sacramento River at the intake to the water treatment facility in Sacramento, approximately 0.3 km downstream from confluence with American River, in Sacramento County.

Figure 2. Acres treated with molinate in Colusa and Glenn Counties and concentrations of molinate in the Colusa Basin Drain near SR20 in 1997.

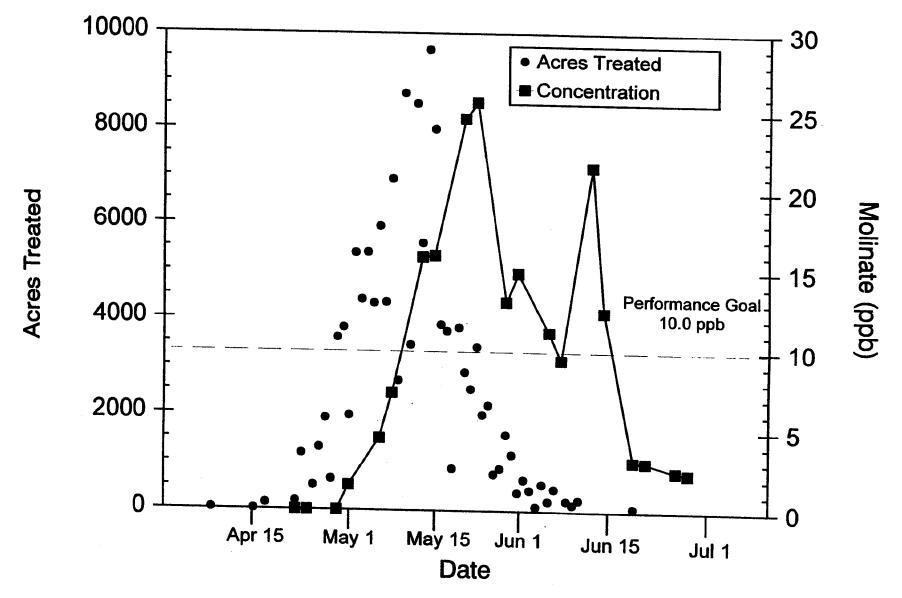


Figure 3. Acres treated with molinate in Butte County and concentrations of molinate in the Butte Slough near SR20 in 1997.

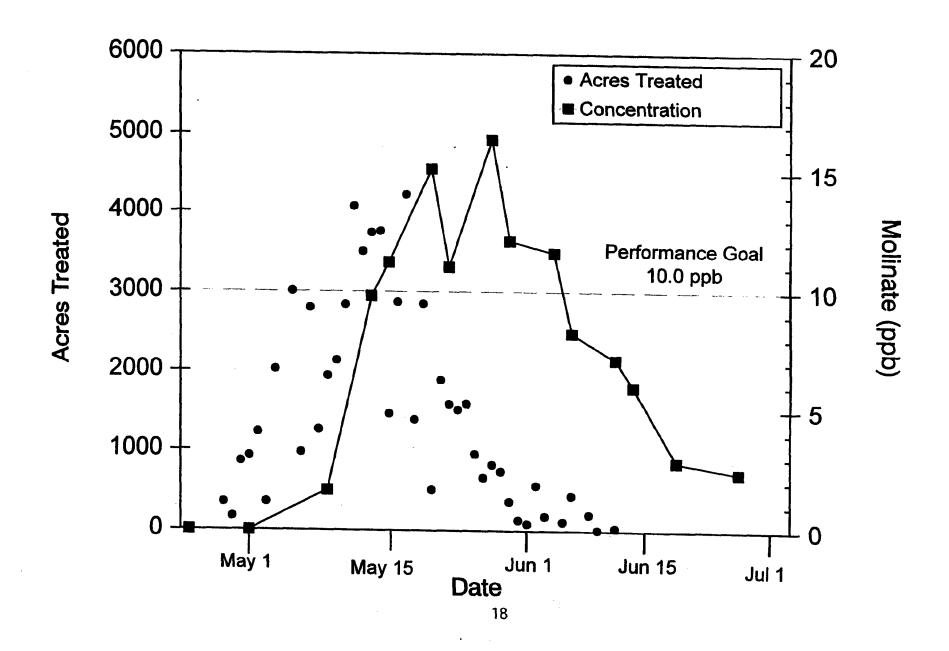


Figure 4. Acres treated with thiobenarb in Colusa and Glenn Counties and concentrations of thiobencarb in the Colusa Basin Drain near SR20 in 1997.

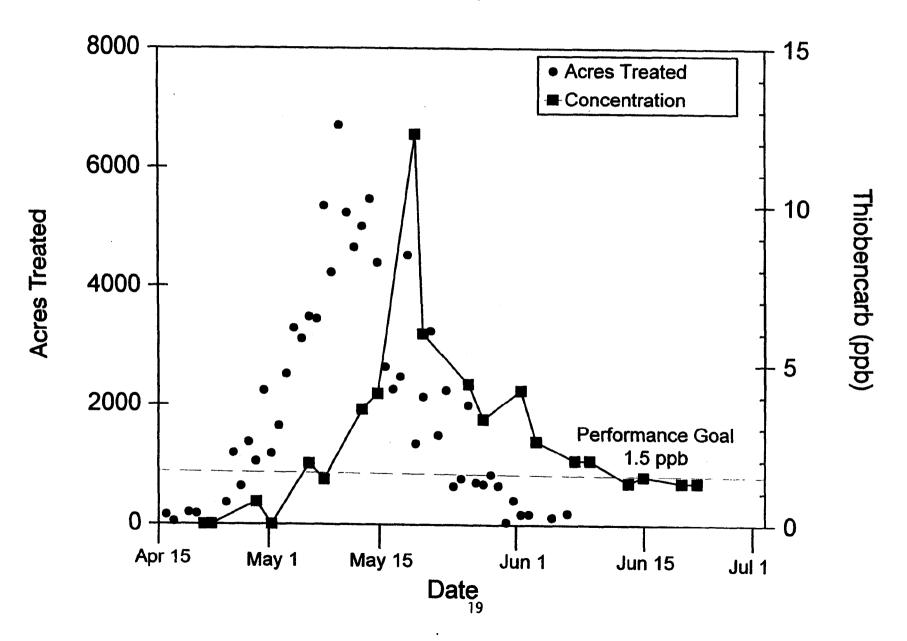


Figure 5. Acres treated with methyl parathion in Colusa and Glenn Counties and concentrations of methyl parathion in the Colusa Basin Drain near SR20 in 1997.

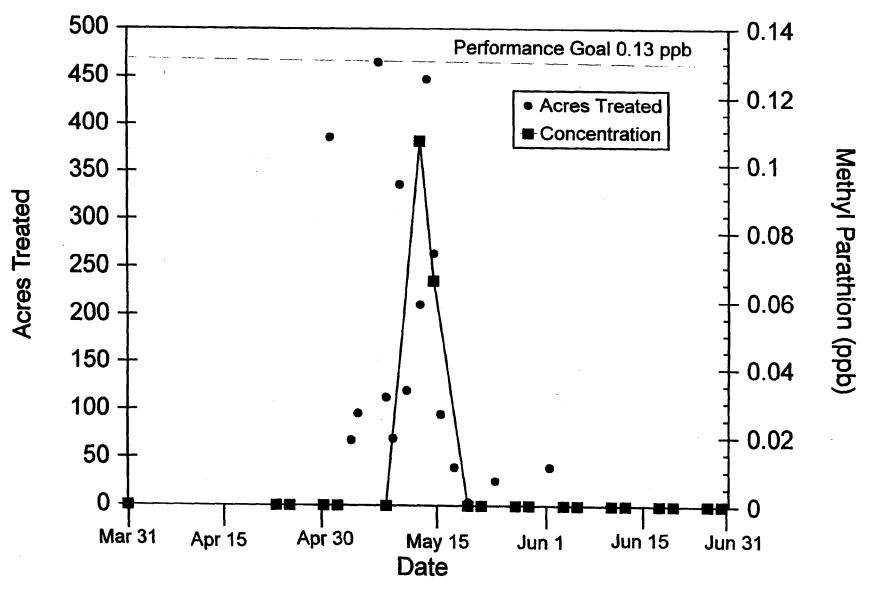


Figure 6. Acres teated with carbofuran in Colusa and Glenn Counties and concentrations of carbofuran in the Colusa Basin Drain near SR20 in 1997.

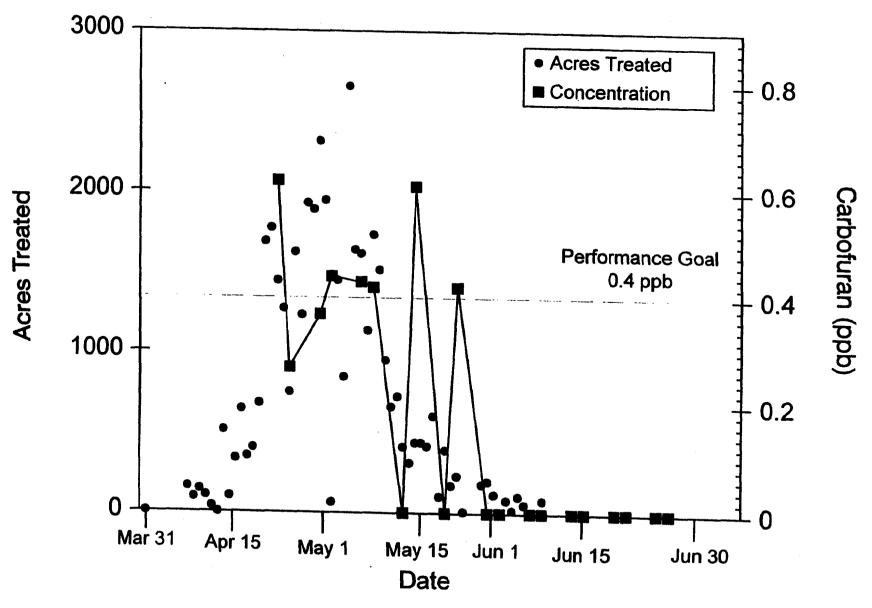


Table 1. Acres treated with molinate (Ordram[®])¹, thiobencarb (Bolero[®] and Abolish[®]), carbofuran (Furadan[®]), and methyl parathion in the counties of the Sacramento Valley in 1997².

	Acres treated				
County	molinate	thiobencarb	carbofuran	methyl parathion	
Butte	61,482	31,163	46,205	1,261	
Colusa	71,205	76,459	22,277	2,067	
Glenn	69,849	19,712	20,803	1,122	
Placer	9,818	9,641	5,661	820	
Sacramento	5,279	5,908	1,177	346	
Sutter	62,451	49,381	20,094	4,862	
Tehama	464	197	298	0	
Yolo	12,511	10,886	402	402	
Yuba	15,525	20,695	21,258	2,381	
Totals	308,584	224,042	138,175	13,261	

- 1. Molinate may be applied more than once at each site.
- 2. Most values are based on Notices-of-Application and pesticide use reports, when available, submitted to county agricultural commissioners.

Table 2. Acres of molinate-treated rice fields where water was discharged under emergency release variances in the Sacramento Valley in 1987 - 1997.

		Percent of total
Year	Acres	acres treated
1987	5,712	1.94
1988	4,897	1.41
1989	3,235	0.86
1990	23,394	6.32
1991	2,224	0.70
1992	1,029	0.29
1993	10,350	2.50
1994	172	0.04
1995	772	0.23
1996	5,193	1.46
1997	535	0.17

PRELIMINARY DATA/SUBJECT TO CHANGE

Table 3. 1997 Pesticide Concentrations at the Colusa Basin Drain near Highway 20 in Colusa County (CBD5) in parts per billion (ppb).

	Molir	nate	Thiobe	ncarb	Carbo	furan	Methyl parathion	Malathion
Laboratory type	Primary	QC	Primary	QC	Primary	QC	Primary	Primary
Reporting limit (ug/l)	1.0	0.5	0.5	0.5	0.35	0.05	0.05	0.05
Date								
3/31	ND	ND	ND	ND	ND	ND	, ND	ND
4/22	ND	ND	ND	ND	0.62	0.634	ND	ND
4/24	ND	ND	ND	ND	0.27	0.297	ND	ND
4/29	ND	0.523	0.7	0.732	0.37	0.349	ND	ND
5/01	1.55	1.85	ND	0.50	0.44	0.415	ND	ND
5/06	4.49	ND	1.9	0.917	0.43	0.369	ND	ND
5/08	7.31	7.35	1.4	1.32	0.42	0.360	ND	ND
5/13	15.87	NS	3.6	NS	ND	NS	0.107	ND
5/15	15.96	15.7	4.1	4.17	0.61	0.571	0.066	ND
5/20	24.65	NS	12.3	NS	ND	NS	ND	ND
5/22	25.67	29.0	6.0	6.96	0.42	0.408	ND	ND
5/27	13.07	NS	4.4	NS	ND	NS	ND	ND
5/29	14.88	11.9	3.3	2.95	ND	0.204	ND	ND

Samples collected by Kleinfelder, Inc. under contract with the California Rice Industry Association. Continued on next page...

Table 3, continued. 1997 Pesticide Concentrations at the Colusa Basin Drain near Highway 20 in Colusa County (CBD5) in parts per billion (ppb).

	Molin	ate	Thiobe	ncarb	Carbo	furan	Methyl parathion	Malathion
Laboratory type	Primary	QC	Primary	QC	Primary	QC	Primary	Primary
Reporting limit (ug/l)	1.0	0.5	0.5	0.5	0.35	0.05	0.05	0.05
Date								
6/3	11.16	NS	4.2	NS	ND	NS	ND	ND
6/5	9.41	9.51	2.6	2.58	ND	0.273	. ND	ND
6/10	21.60	NS	2.0	NS	ND	NS	ND	ND
6/12	12.44	13.1	2.0	2.05	ND	0.154	ND	ND
6/17	3.10	NS	1.3	NS	ND	NS	ND	ND
6/19	3.05	4.13	1.5	1.51	ND	0.140	ND	ND
6/24	2.49	NS	1.3	NS	ND	NS	ND	ND
6/26	2.37	2.81	1.3	ND	ND	0.152	ND	ND

Key to designations on rice water monitoring table for CBD5:

QC	Quality control	PEHFORMANCE GOALS (ppb):			
Blank cells	Results not yet reported				
ND	Not detected	molinate	10	methyl parathion	0.13
NS	Not sampled	thiobencarb	1.5	malathion	0.1
	,	carbofuran	0.4		

PRELIMINARY DATA/SUBJECT TO CHANGE

Table 4. 1997 Pesticide Concentrations at Butte Slough at Lower Pass Road in Sutter County in parts per billion (ppb).

	Molinate	Thiobencarb	Carbofuran	Methyl parathion	Malathion
Laboratory type	Primary	Primary	Primary	Primary	Primary
Reporting limit (ug/l)	1.0	0.5	0.35	0.05	0.05
Date				·	
3/31	ND	ND	ND	ND	ND
4/22	ND	ND	ND	ND	ND
4/29	ND	ND	ND	ND	ND
5/06	ND	ND	0.59	ND	ND
5/08	1.67	ND	0.55	0.07	ND
5/13	9.83	ND	ND	ND	ND
5/15	11.22	ND	ND	ND	ND
5/20	15.16	1.0	0.39	ND	ND
5/22	11.04	1.5	0.37	ND	ND
5/27	16.42	2.2	ND	ND	ND
5/29	12.12	1.6	ND	ND	ND

Samples collected by Kleinfelder, Inc. under contract with the California Rice Industry Association. Continued on next page...

Table 4, continued. 1997 Pesticide Concentrations at Butte Slough at Lower Pass Road in Sutter County in parts per billion (ppb).

Daiman				
Primary	Primary	Primary	Primary	Primary
1.0	0.5	0.35	0.05	0.05
11.62	1.0	ND	ND	ND
8.27	1.0	ND	ND	0.05
7.16	0.6	ND	ND	ND
6.00	ND	ND	ND	ND
2.85	ND	ND	ND	ND
2.41	ND	ND	ND	ND
	11.62 8.27 7.16 6.00 2.85	11.62 1.0 8.27 1.0 7.16 0.6 6.00 ND 2.85 ND	11.62 1.0 ND 8.27 1.0 ND 7.16 0.6 ND 6.00 ND ND 2.85 ND ND	11.62 1.0 ND ND 8.27 1.0 ND ND 7.16 0.6 ND ND 6.00 ND ND ND 2.85 ND ND ND

Key to designations on rice water monitoring table for Butte Slough:

Blank cells		PERFORMANCE GOALS (ppb):			
	Results not yet reported		(PPA)		
ND	Not detected	molinate	10	methyl parathion	0.13
NS	Not sampled	thiobencarb	1.5	malathion	0.1
		carbofuran	0.4		

PRELIMINARY DATA/SUBJECT TO CHANGE

Table 5. 1997 Pesticide Concentrations in the Sacramento River at the Village Marina in Sacramento County in parts per billion (ppb).

	Molinate	Thiobencarb	Carbofuran	Methyl parathion	Malathion
Laboratory type	<u>Primary</u>	Primary	Primary	Primary	Primary
Reporting limit (ug/l)	1.0	0.5	0.35	0.05	0.05
Date					
3/31	ND		ND	ND	ND
4/22	ND	ND	ND	ND	ND
4/29	ND	ND	ND	ND	ND
5/06	ND	ND	ND	ND	ND
5/08	ND	ND	ND	ND	ND
5/13	ND	ND	ND	ND	ND
5/15	ND	ND	ND	ND	ND
5/20	1.02	ND	ND	ND	ND
5/22	1.66	ND	ND	ND	ND
5/27	1.72	ND	ND	ND	ND
5/29	1.18	ND	ND	ND	ND

Samples collected by Kleinfelder, Inc. under contract with the California Rice Industry Association. Continued on next page...

Table 5, continued. 1997 Pesticide Concentrations in the Sacramento River at the Village Marina in Sacramento County in parts per billion (ppb).

	Molinate	Thiobencarb	Carbofuran	Methyl parathion	Malathion
Laboratory type	Primary	Primary	Primary	Primary	Primary
Reporting limit (ug/l)	1.0	0.5	0.35	0.05	0.05
Date					
6/3	ND	ND	ND	ND	ND
6/5	ND	ND	ND	ND	ND
6/10	ND	ND	ND	ND	ND
6/12	ND	ND	ND	ND	ND
6/17	ND	ND	ND	ND	ND
6/24	ND	ND	ND	ND	ND

Key to designations on rice water monitoring table for the Sacramento River at the Village Marina:

Blank cells ND		PERFORMANCE GOALS (ppb):					
	Results not yet reported Not detected	molinate	10	methyl parathion	0.13		
NS	Not sampled	thiobencarb	1.5	malathion	0.1		
		carbofuran	0.4				

Table 6. Concentrations of molinate and thiobencarb in the Sacramento River at the intake to the City of Sacramento water treatment facility (SRRAW) in 1997¹.

	Concentration (ppb)		
Date	molinate	thiobencarb	
5/15	0.29	< 0.10	
5/19	0.62	< 0.10	
5/21	1.3	< 0.10	
5/26	0.68	< 0.10	
5/30	0.51	< 0.10	
6/02	0.53	< 0.10	
6/04	0.25	< 0.10	
6/06	0.41	< 0.10	
6/09	0.42	< 0.10	
6/11	0.27	< 0.10	

1. Samples collected and analyzed by the City of Sacramento.

Table 7. Peak molinate concentrations in selected Sacramento Valley waterways¹ in 1981 - 1997.

		Concentration (ppb) ²			
Year	CBD1	CBD5	<u>SS1</u>	BS1	SR1
1981	340	357	3		
1982	204	697		187	27
1983	211	228	68		7
1984	110	120	44		21
1985	95	100	49		16
1986	77	88	30		11
1987	43	53	22	44	8
1988	67	89	30	52	8
1989	51	60	30	43	6
1990	51	59	40	36	9
1991	18	17	10	26	1
1992	6	24	15	26	ND⁴
1993	695	96	31	39	3
1994	21	57	10	18	
1995		25		8	ND^4
1996		44		15	1
1997		26		16	2

1. CBD1	Colusa Basin Drain at Roads 109 and 99E near Knight's Landing in Yolo
	County.

CBD5 Colusa Basin Drain at or near Highway 20 in Colusa County.

- 2. All concentration values rounded to the nearest whole number.
- 3. Blanks indicate no data are available.
- 4. ND None detected. Method detection limit = 1.0 ppb.
- 5. Mean of duplicate analyses.

SS1 Sacramento Slough at DWR gauge station in Sutter County.

BS1 Butte Slough at Highway 20 in Sutter County.

SR1 Sacramento River at Village Marina in Sacramento County.

Table 8: Peak thiobencarb concentrations in selected Sacramento Valley waterways in 1981 - 1997.

	•		Concentration (ppb) ²		
Year	CBD1	CBD5	<u>SS1</u>	BS1	SR1
1981	21	23	3		
1982	57	170		10	6
1983	11	9	5		1
1984	8	14	8		1
1985	19	18	11		4
1986	7	7	4		1
1987	4	2	1	ND^4	ND
1988	4	1	ND	1	ND
1989	1	1	ND	1	ND
1990	ND	ND	ND	2	ND
1991	ND	ND	ND	ND	ND
1992	6	7	2	10	ND
1993	5	4	ND	ND	ND
1994	16	37 ⁵	ND	1	
1995		4		1	ND
1996		16		2	ND
1997		12		2	ND

1. CBD1	Colusa Basin Drain at Roads 109 and 99E near Knight's Landing in
	Yolo County.
CBD5	Colusa Basin Drain at Highway 20 in Colusa County.
SS1	Sacramento Slough at DWR gauge station in Sutter County.
BS1	Butte Slough at Highway 20 in Sutter County.
SR1	Sacramento River at Village Marina in Sacramento County.

- 2. Concentration values are rounded to the nearest whole number.
- 3. Blanks indicate no data are available.
- 4. ND Not detected. Different detection limits (lowest quantifiable concentrations) were reported during this period, all of which were less than or equal to 1.0 ppb.
- 5. A second extraction and analysis was conducted with a rounded result of 40 ppb.

Table 9. Estimated mass transport of molinate and thiobencarb in the Sacramento River past Sacramento in the years 1982-1996.

		Kg (pounds) Transported		
<u>Year</u>	molinate		thic	bencarb
1982	18,464.9	(40,666.9)	1	
1983^{2}	2,752.9	(6,056.5)	623.7	(1,372.2)
1984	7,352.0	(16,174.4)	715.2	(1,573.5)
1985	6,014.8	(13,232.5)	2,317.5	(5,098.6)
1986	4,622.1	(10,168.7)	845.7	(1,860.6)
1987	2,342.3	(5,153.2)	22.8	(50.2)
1988	3,194.2	(7,027.2)	68.1	(149.8)
1989	1,984.1	(4,365.1)	11.4	(25.1)
1990	3,204.1	(7,049.1)	51.4	(113.1)
1991	99.2	(217.9)	0	$(0)^3$
1992	56.6	(124.7)	0	(0)
1993 ²	2,006.9	(4,232.4)	0	(0)
1994	109.1	(239.9)	0	(0)
1995	83.7	(184.4)	0	(0)
1996	204.1	(449.0)	0	(0)

- 1. Mass transport was not calculated due to incomplete monitoring data.
- 2. The Colusa Basin Drain, a major agricultural drainage canal, did not contribute to the mass transport at Sacramento during all or part of the sampling period because the drain was routed into the Yolo Bypass during unusually high Sacramento River flows.
- 3. Thiobencarb was not detected in the Sacramento River in 1991 1994 (limit of detection = 0.1 ppb).

Appendix A

California Environmental Protection Agency

James M. Strock. Secretary for Environmental Protection

State of California
Pete Wilson, Governor

DEPARTMENT OF PESTICIDE REGULATION James W. Wells, Director

1020 N Street, Room 100 Sacramento, California 95814-5624

March 8, 1995

TO:

COUNTY AGRICULTURAL COMMISSIONERS

IN RICE-GROWING COUNTIES OF THE SACRAMENTO VALLEY

SUBJECT: 1995 RICE PESTICIDES PROGRAM

On January 27, 1995, the Central Valley Regional Water Quality Control Board (CVRWQCB) approved management practices that limit discharges of the rice pesticides molinate (Ordram®), thiobencarb (Bolero® and Abolish®), carbofuran (Furadan®), methyl parathion, and malathion to surface waters. The CVRWQCB staff sent you a copy of the agenda item for this meeting along with a report prepared by my staff entitled: "Information on Rice Pesticides Submitted to the Central Valley Regional Water Quality Control Board" (December 28, 1995). This letter contains details on the 1995 rice pesticide program including conditions you are asked to implement for rice pesticide permits.

Most of the provisions of the rice pesticide program relating to routine water-holding times will remain the same as in 1994. However, changes will apply for regions previously considered hydrologically isolated to ensure compliance with the CVRWQCB's prohibition of acutely toxic discharges to waters that support aquatic habitat.

In addition, the CVRWQCB approved management plans to promote an educational effort with the rice-growing community that stresses the continued importance of drift prevention and introduces the potential contributions seepage water makes to the pesticide concentrations in the agricultural drains. Drift control provisions remain as they were in 1994. Continue to have your staff impress upon commercial applicators the need to better control applications of pesticides near agricultural drains and focus additional enforcement efforts, when possible, on aerial applications made to fields adjacent to agricultural drains. My



County Agricultural Commissioners in Rice Growing Counties
March 8, 1995
Page Two

staff is working with representatives from the rice-growing community to propose voluntary measures growers might take to prevent rice field seepage water from entering surface waterways prior to the end of the required holding periods for field water. Your assistance in distributing forthcoming information to growers on seepage water containment will be appreciated.

The key features of the 1995 program are as follows:

- 1. The basic water management requirements for users of those pesticides that require permits (molinate, thiobencarb, methyl parathion, and carbofuran) are the same as in 1994. The water management requirements for the 1995 program as approved by the CVRWQCB are outlined in Attachments 1-4. Holding times for all applications (not just the "preflood surface" applications) of Abolish decreased to 19 days. Areas considered hydrologically isolated must hold water from fields treated with molinate and thiobencarb for longer periods (11 and 19 days, respectively) than previously required. Exceptions for some fields treated with thiobencarb are described in Attachment 2.
- 2. The water management practices following malathion use in rice are still voluntary. Attachment 5, which describes these practices, was designed to be distributed to growers.
- 3. Management practices for containing seepage water from rice fields and the pesticides this water may contain will be addressed through forthcoming educational measures and implemented through voluntary efforts by growers.
- 4. Water management practices within closed systems remain the same for 1995. The Department of Pesticide Regulation (DPR) will conduct a study on toxicity of water in multigrower closed systems to determine any need for longer holds in future years.

County Agricultural Commissioners in Rice Growing Counties March 8, 1995 Page Three

- The emergency release provisions remain the same as in 1994 5. to continue to meet the CVRWQCB's prohibition of acutely toxic discharges to waters that support aquatic habitat. Growers with fields treated with Ordram may apply for an emergency release after a minimum holding period of 11 days. Fields will be prohibited from using the emergency release management option until the standard holding times for the insecticides have elapsed. Fields treated with Bolero do not qualify for the emergency release option. Attachment 6 is the form which permittees are to fill out as part of their request for an emergency release. Those that are granted an emergency release must also fill out an additional form (Attachment 7) and deliver it to your office. Failure to submit this form will be considered a permit violation. DPR staff will request the information on the completed forms later this summer.
- 6. Growers using the emergency release provision more than once or cited for water holding violations more than once must make improvements in water management capabilities. Such improvements will be required as conditions on future pesticide use permits and may include retention basins, ponds, or tailwater recovery systems.
- 7. Drift control provisions will again be an important part of the program. Methyl parathion application provisions are the same as in 1994. They include the use of an effective drift control agent, use of D8 nozzles, wind speeds ≤ 5 miles per hour, and a 300-foot downwind buffer zone left untreated. Attachments 8, 9, 10, and 11 outline the provisions for aerial applications of granular and liquid formulations of rice pesticides included in the program. Special attention should be directed, when possible, towards enforcement efforts during aerial applications at sites adjacent to agricultural drains.
- 8. Weir boxes that control discharges of water from rice fields shall be fully secured during pesticide holding times. A soil berm must be in place in front of each of these boxes

County Agricultural Commissioners in Rice Growing Counties March 8, 1995 Page Four

to a level above the water line, or drop boxes shall be filled with soil to a level above the water line. The need for such berms in fields where nonconventional water management systems are utilized, e.g., static/positive pressure systems, may be evaluated by County Agricultural Commissioner's office staff on a case-by-case basis.

Information transmittal of rice pesticide use data from the county offices to DPR will be handled at the end of July rather than on a weekly basis. My staff will discuss the details of this process with your deputies.

Monitoring results will not be available this year until approximately five weeks after sample collection. DPR will continue to send monitoring program results to your offices, via facsimile, when available.

Thank you for your assistance. Your cooperation continues to help make the program a real success. If you have questions, please contact Dr. Nan Gorder at (916) 324-4265 or Mr. Marshall Lee at (916) 324-4269.

Sincerely,

James W. Wells

Director

(916) 445-4000

cc: Dr. Nan Gorder

Mr. Marshall Lee

MOLINATE WATER MANAGEMENT REQUIREMENTS - 1995

- I. All water from fields treated with products containing molinate must be retained on the site of application for at least 28 days following application unless:
 - A. The water is contained within a tailwater recovery system, ponded on fallow land, or contained in other systems appropriate for preventing discharge. The system may discharge 29 days following the last application of molinate within the system.
 - 1. If the system is under the control of one permittee, water may be discharged from the application site in a manner consistent with product labeling.
 - 2. If the system includes drainage from more than one permittee, water may be discharged from the application site into the system nine days following application.
 - B. The water is on acreage within the bounds of areas that discharge negligible amounts of rice field drainage into perennial streams until fields are drained for harvest. All water on fields treated with molinate must be retained on the treated acreage until the twelfth day following application.
 - C. The water is on acreage treated with a preflood application of molinate. The label restrictions apply.
- II. Fields not specified in I.A., I.B., and I.C. may resume discharging field water 29 days following application at a volume not to exceed two inches of water over a drain box weir. Unregulated discharges from these fields may then resume after seven days.

MOLINATE WATER MANAGEMENT REQUIREMENTS - 1995

III. The county agricultural commissioner may authorize the emergency release of tailwater 12 days following the last molinate application, following a review of a written request (Attachment 6) which clearly demonstrates the crop is suffering because of the water management requirements. All water management requirements must be followed that are associated with other pesticides that may have been applied to the site. Additionally, the requester must describe preventative action that would avoid the need for future emergency releases. Under an emergency release variance, tailwater may be released only to the extent necessary to mitigate the documented problem. Those issued an emergency release must submit to the county agricultural commissioner a report (Attachment 7) indicating the time and duration of the emergency release and data that can be used to calculate the total amount of water released during the emergency release. Emergency release will only be granted for reasons related to rainfall, high winds, or other extreme weather conditions that cannot be moderated with management practices.

SUPPLEMENT TO WATER MANAGEMENT REQUIREMENTS FOR MOLINATE - 1998

- IV. The county agricultural commissioner may authorize the emergency release of field water on the 12th day following the last molinate application, following the review of a written application that demonstrates salinity levels are damaging to the crop.
 - A. Applicants for such emergency releases must provide the following information:
 - 1. all information indicated on the emergency release request form (Attachment A), including a description of the severity and extent of salinity damage.
 - 2. electrical conductivity (EC) measurements, expressed as deciSiemans per meter (dS/m) or microSiemans per centimeter ($\mu S/cm$), from field water in each paddy suspected of having salinity problems. To most effectively demonstrate salinity problems, measurements should be taken wherever salinity problems are evident.
 - 3. the instrument (make and model) used to determine EC measurements. The instrument must have a sensitivity range that accommodates the full range of EC values in intake and paddy water (usually a range of 0-5.0 dS/m or 0-5.000 μ S/cm should be sufficient) and should have a resolution of not less than five percent. The instrument must be calibrated according to the manufacturer's instructions. The applicant must specify the method of temperature compensation (i.e., automatic, conversion table).
 - 4. who made the EC measurements.
 - 5. the source of irrigation water (e.g. district supply canal, drainage canal, well, etc.).
 - B. An emergency release may be granted only if all of the following conditions are satisfied:
 - 1. All required information is provided.

APPENDIX A

ATTACHMENT 1

- 2. Water management requirements for rice pesticides other than molinate are satisfied.
- 3. EC of paddy water exceeds 2.0 dS/m or 2,000 μ S/cm.
- 4. The County Agricultural Commissioner or his or her staff inspects the site.
- C. Water may be released from paddies where EC measurements exceed 2.0 dS/m or 2,000 μ S/cm and from paddies downgradient from such paddies within the same field. Water shall only be released in an amount necessary to mitigate the salinity problem.
- D. Those issued an emergency release must submit to the county agricultural commissioner a report (Attachment B) indicating the time and duration of the emergency release and data that can be used to calculate the total amount of water released during the emergency release.

THIOBENCARB WATER MANAGEMENT REQUIREMENTS - 1995 Revised April 7, 1995

- I. For rice fields treated with thiobencarb in the Sacramento Valley (north of the line defined by Roads E10 and 116 in Yolo County and the American River in Sacramento County), except those treated with Abolish 8EC:
 - A. All water on treated fields must be retained on the treated fields for at least 30 days following application unless:
 - 1. The water is contained within a tailwater recovery system, ponded on fallow land, or contained in other systems appropriate for preventing discharge. The system may discharge 20 days following the last application of thiobencarb within the system.
 - a. If the system is under the control of one permittee, water may be discharged from the application site in a manner consistent with product labeling.
 - b. If the system includes drainage from more than one permittee, water may be discharged from the application site into the system seven days following application.
 - 2. The water is on fields within the bounds of areas that discharge negligible amounts of rice field drainage into perennial streams until fields are drained for harvest. Water from such fields must be held at least 19 days, unless the county agricultural commissioner evaluates such sites. If the commissioner verifies the hydrologic isolation of the fields, the water may be released seven days after application.

THIOBENCARB WATER MANAGEMENT REQUIREMENTS - 1995 Revised April 7, 1995

- B. Fields not specified in I.A.1. and I.A.2. may resume discharging field water 31 days following application at a volume not to exceed two inches of water over a drain box weir. Unregulated discharges from these fields may then resume after seven days.
- II. For rice fields treated with thiobencarb in the Southern Area (south of the line defined by Roads E10 and 116 in Yolo County and the American River in Sacramento County), except those treated with Abolish 8EC:
 - A. All water on treated fields must be retained on the treated fields for at least 19 days following application unless:
 - 1. The water is contained within a tailwater recovery system, ponded on fallow land, or contained in other systems appropriate for preventing discharge. The system may discharge 20 days following the last application of thiobencarb within the system.
 - a. If the system is under the control of one permittee, water may be discharged from the application site in a manner consistent with product labeling.
 - b. If the system includes drainage from more than one permittee, water may be discharged from the application site into the system seven days following application.

THIOBENCARB WATER MANAGEMENT REQUIREMENTS - 1995 Revised April 7, 1995

- 2. The water is on fields within the bounds of areas that discharge negligible amounts of rice field drainage into perennial streams until fields are drained for harvest. Water from such fields may be released seven days after application if the county agricultural commissioner evaluates such sites and verifies the hydrologic isolation of the fields.
- B. Fields not specified in II.A.1. and II.A.2. may resume discharging field water 20 days following application at a volume not to exceed two inches of water over a drain box weir. Unregulated discharges from these fields may then resume after seven days.

III. For all areas, fields treated with Abolish 8EC:

- A. All water on treated fields must be retained on the treated fields for at least 19 days following application unless:
 - 1. The water is contained within a tailwater recovery system, ponded on fallow land, or contained in other systems appropriate for preventing discharge. The system may discharge 20 days following the last application within the system.
 - a. If the system is under the control of one permittee, water may be discharged from the application site in a manner consistent with product labeling.
 - b. If the system includes drainage from more than one permittee, water may be discharged from the application site into the system seven days following application.

THIOBENCARB WATER MANAGEMENT REQUIREMENTS - 1995 Revised April 7, 1995

- 2. The water is on fields within the bounds of areas that discharge negligible amounts of rice field drainage into perennial streams until fields are drained for harvest. Water from such fields may be released seven days after application if the county agricultural commissioner evaluates such sites and verifies the hydrologic isolation of the fields.
- B. Fields not specified in III.A. may resume discharging field water 20 days following application at a volume not to exceed two inches of water over a drain box weir.

 Unregulated discharges from these fields may then resume after seven days.

SUPPLEMENT TO WATER MANAGEMENT REQUIREMENTS FOR THIOBENCARB - 1998

j,

- IV. The county agricultural commissioner may authorize the emergency release of field water on the 20th day following the last thiobencarb application, following the review of a written application that demonstrates salinity levels are damaging to the crop.
 - A. Applicants for such emergency releases must provide the following information:
 - 1. all information indicated on the emergency release request form (Attachment A), including a description of the severity and extent of salinity damage.
 - 2. electrical conductivity (EC) measurements, expressed as deciSiemans per meter (dS/m) or microSiemans per centimeter $(\mu S/cm)$, from field water in each paddy suspected of having salinity problems. To most effectively demonstrate salinity problems, measurements should be taken wherever salinity problems are evident.
 - 3. the instrument (make and model) used to determine EC measurements. The instrument must have a sensitivity range that accommodates the full range of EC values in intake and paddy water (usually a range of 0-5.0 dS/m or 0-5,000 μ S/cm should be sufficient) and should have a resolution of not less than five percent. The instrument must be calibrated according to the manufacturer's instructions. The applicant must specify the method of temperature compensation (i.e., automatic, conversion table).
 - 4. who made the EC measurements.
 - 5. the source of irrigation water (e.g. district supply canal, drainage canal, well, etc.).
 - B. An emergency release may be granted only if all of the following conditions are satisfied:
 - 1. All required information is provided.

APPENDIX A

ATTACHMENT 2

- 2. Water management requirements for rice pesticides other than thiobencarb are satisfied.
- 3. EC of paddy water exceeds 2.0 dS/m or 2,000 μ S/cm
- 4. The County Agricultural Commissioner or his or her staff inspects the site.
- C. Water may be released from paddies where EC measurements exceed 2.0 dS/m or 2,000 μ S/cm and from paddies downgradient from such paddies within the same field. Water shall only be released in an amount necessary to mitigate the salinity problem.
- D. Those issued an emergency release must submit to the county agricultural commissioner a report (Attachment B) indicating the time and duration of the emergency release and data that can be used to calculate the total amount of water released during the emergency release.

CARBOFURAN WATER MANAGEMENT REQUIREMENTS - 1995

- I. Pre-flood applications of carbofuran to rice fields must be incorporated into the soil.
- II. Water shall not be discharged from sites treated with carbofuran for at least 28 days following initial flooding (pre-flood application) or following application (post-plant application) unless the treated water is contained within tailwater recovery systems, ponded on fallow land, or contained in other systems appropriate for preventing discharge. The system may discharge 29 days following the last application of carbofuran within the system.
 - A. If the system was under the control of one permittee, treated water may be discharged from the application site in a manner consistent with product labeling.
 - B. If the system includes drainage from more than one permittee, treated water may be discharged from the application site into the system nine days following application.

METHYL PARATHION WATER MANAGEMENT REQUIREMENTS - 1995

Water shall not be discharged from sites treated with methyl parathion for at least 24 days following application unless the treated water is contained within a tailwater recovery system, ponded on fallow land, or contained in other systems appropriate for preventing discharge. The system may discharge 25 days following the last application of methyl parathion within the system. Treated water may be discharged from the application site in a manner consistent with product labeling.

MALATHION WATER MANAGEMENT REQUIREMENTS - 1995

The Central Valley Regional Water Quality Control Board has approved a water management practice following malathion use in rice that will help meet 1995 water quality performance goals for malathion in surface water. Malathion is currently not a restricted material and not subject to use requirements or permit conditions. However, it is important that growers comply with this practice.

Water from fields treated with malathion should be held on the site of application for at least four days following application.

Water quality monitoring will be conducted in 1995 to determine the adequacy of this practice in managing malathion discharges. If malathion levels do not adequately meet the performance goal, a more formal regulatory program may be implemented in future years.

EMERGENCY RELEASE

Grower:	Permit No.:			
Address:	Zip:			
Field location:	Site No.:			
(Attach detailed map)				
Chemical applied:	Chemical applied:			
	Rate of application:			
	Date of application:			
	Average water depth:			
	at time of application:			
Chemical applied:	Chemical applied:			
	Rate of application:			
	Date of application:			
Average water depth				
at time of application:				
Starting date of emergency release:				
Acres in field:	Laser leveled? YesNo			
Type of irrigation system: Flow through_	RecycleStaticOther			
Date flooding began:No	o. of days it takes to fill field:			
Describe problem that led to emergency relea	ase:			
Steps that can be taken to prevent emergency	releases from this field in future years:			
Recommendation (attached) by				
Applications by:				
Grower's signature:	Date:			
Approved by:				
	Agricultural Biologist			

EMERGENCY RELEASE

Address: Field location:				Permit No.: Zip: Site No.:										
								Beginning date	of release:		· · · · · · · · · · · · · · · · · · ·	Ending date: _	· ·	_
								To do this, mea	asure the width o	amount of water of each weir open wing over each w	ed to allow the	discharge. Then	cy release period , on a daily basis, he table below.	,
W	eir 1	Weir 2		 										
Width:		 Width:		 Width:										
Date	Height of water	Date	Height of water	Date	Height of water									
		<u> </u>				ŀ								
	 -													
	1													

DRIFT CONTROL REQUIREMENTS FOR GRANULAR MOLINATE, THIOBENCARB, AND CARBOFURAN APPLIED TO RICE - 1995

Granular molinate, thiobencarb, or carbofuran drifting into waterways (i.e., drainage canals) or onto levees or roadways adjacent to waterways will be considered environmental contamination. Applicators found in violation will be liable for a civil penalty.

Granular molinate, thiobencarb, or carbofuran shall not be applied by air if wind speed is greater than seven miles per hour to avoid drift into drainage canals and ditches.

DRIFT CONTROL REQUIREMENTS FOR LIQUID THIOBENCARB APPLIED TO RICE - 1995

I. Aerial Applications

- A. No aerial applications of liquid formulations of thiobencarb to rice shall be:
 - 1. Discharged more than ten feet above the crop or target. Discharge shall be shut off whenever it is necessary to raise the equipment over obstacles such as trees or poles.
 - Applied when wind velocity is more than seven miles per hour.
 - 3. Applied by aircraft except as follows:
 - a. The flow of liquid to aircraft nozzles shall be controlled by a positive shutoff system as follows:
 - i. Each individual nozzle shall be equipped with a check valve and the flow controlled by suckback device or a boom pressure release device; or
 - ii. Each individual nozzle shall be equipped with a positive action valve.
 - b. Aircraft nozzles shall not be equipped with any device or mechanism which would cause a sheet, cone, fan, or similar type dispersion of the discharged material except as otherwise provided.
 - c. Aircraft boom pressure shall not exceed 40 pounds per square inch.
 - d. Aircraft nozzles shall be equipped with orifices directed backward parallel to the horizontal axis of the aircraft in flight.

DRIFT CONTROL REQUIREMENTS FOR LIQUID THIOBENCARB APPLIED TO RICE - 1995

- e. Fixed wing aircraft and helicopters operating in excess of 60 miles per hour shall be equipped with jet nozzles having an orifice of not less than 1/16 inch diameter.
- f. Working boom length on fixed wing aircraft shall not exceed 3/4 of the wing span; the working boom length of helicopters shall not exceed 6/7 of the total rotor length or 3/4 of the total rotor where the rotor length exceeds 40 feet.
- g. Helicopters operating at 60 miles per hour or less shall be equipped with:
 - Nozzles having an orifice not less than 1/16 inch in diameter. A number 46 (or equivalent) or larger whirlplate may be used; or
 - ii. Fan nozzles with a fan angle number not larger than 80 degrees and a flow rate not less than one gallon per minute at 40 pounds per square inch pressure (or equivalent).
- B. Special precautions should be taken to avoid off-site deposition of liquid formulations of pesticides when applications are made adjacent to agricultural drains.
- II. Ground Applications Ground applications of liquid thiobencarb must be applied as per label instructions.

DRIFT CONTROL RECOMMENDATIONS FOR MALATHION APPLIED TO RICE - 1995

- I. No aerial applications of liquid formulations of malathion to rice shall be:
 - A. Discharged more than ten feet above the crop or target. Discharge shall be shut off whenever it is necessary to raise the equipment over obstacles such as trees or poles.
 - B. Applied when wind velocity is more than seven miles per hour.
 - C. Applied by aircraft except as follows:
 - 1. The flow of liquid to aircraft nozzles shall be controlled by a positive shutoff system as follows:
 - a. Each individual nozzle shall be equipped with a check valve and the flow controlled by suckback device or a boom pressure release device; or
 - b. Each individual nozzle shall be equipped with a positive action valve.
 - 2. Aircraft nozzles shall not be equipped with any device or mechanism which would cause a sheet, cone, fan, or similar type dispersion of the discharged material except as otherwise provided.
 - 3. Aircraft boom pressure shall not exceed 40 pounds per square inch.
 - 4. Aircraft nozzles shall be equipped with orifices directed backward parallel to the horizontal axis of the aircraft in flight.

DRIFT CONTROL RECOMMENDATIONS FOR MALATHION APPLIED TO RICE - 1995

- 5. Fixed wing aircraft and helicopters operating in excess of 60 miles per hour shall be equipped with jet nozzles having an orifice of not less than 1/16 inch diameter.
- 6. Working boom length on fixed wing aircraft shall not exceed 3/4 of the wing span; the working boom length of helicopters shall not exceed 6/7 of the total rotor length or 3/4 or the total rotor where the rotor length exceeds 40 feet.
- 7. Helicopters operating at 60 miles per hour or less shall be equipped with:
 - a. Nozzles having an orifice not less than 1/16 inch in diameter. A number 46 (or equivalent) or larger whirlplate may be used; or
 - b. Fan nozzles with a fan angle number not larger than 80 degrees and a flow rate not less than one gallon per minute at 40 pounds per square inch pressure (or equivalent).
- II. Special precautions should be taken to avoid off-site deposition of liquid formulations of pesticides when applications are made adjacent to agricultural drains.

DRIFT CONTROL REQUIREMENTS FOR METHYL PARATHION APPLIED TO RICE - 1995

I. Aerial Applications

- A. No aerial applications of liquid formulations of methyl parathion to rice shall be:
 - 1. Discharged more than ten feet above the crop or target. Discharge shall be shut off whenever it is necessary to raise the equipment over obstacles such as trees or poles.
 - 2. Applied within a 300 foot downwind buffer zone from any agricultural drain.
 - 3. Applied when wind velocity is more than five miles per hour.
 - 4. Applied without an effective drift control agent.
 - 5. Applied by aircraft except as follows:
 - a. The flow of liquid to aircraft nozzles shall be controlled by a positive shutoff system as follows:
 - i. Each individual nozzle shall be equipped with a check valve and the flow controlled by suckback device or a boom pressure release device; or
 - ii. Each individual nozzle shall be equipped with a positive action valve.
 - b. Aircraft nozzles shall not be equipped with any device or mechanism which would cause a sheet, cone, fan, or similar type dispersion of the discharged material except as otherwise provided.

DRIFT CONTROL REQUIREMENTS FOR METHYL PARATHION APPLIED TO RICE-1995

- c. Aircraft boom pressure shall not exceed 40 pounds per square inch.
- d. Aircraft nozzles shall be equipped with orifices directed backward parallel to the horizontal axis of the aircraft in flight.
- e. Fixed wing aircraft and helicopters operating in excess of 60 miles per hour shall be equipped with jet nozzles having an orifice of not less than 1/8 inch diameter.
- f. Working boom length on fixed wing aircraft shall not exceed 3/4 of the wing span; the working boom length of helicopters shall not exceed 6/7 of the total rotor length or 3/4 of the total rotor where the rotor length exceeds 40 feet.
- g. Helicopters operating at 60 miles per hour or less shall be equipped with:
- Nozzles having an orifice not less than 1/8 inch in diameter. A number 46 (or equivalent) or larger whirlplate may be used; or
- ii. Fan nozzles with a fan angle number not larger than 80 degrees and a flow rate not less than one gallon per minute at 40 pounds per square inch pressure (or equivalent).
- B. Special precautions should be taken to avoid off-site deposition of liquid formulations of pesticides when applications are made adjacent to agricultural drains.

DRIFT CONTROL REQUIREMENTS FOR METHYL PARATHION APPLIED TO RICE-1995

- II. Ground Applications Ground equipment other than handguns shall be equipped with
 - A. Nozzles having an orifice not less than 1/16 inch in diameter or equivalent, and operated at a boom pressure not to exceed 30 pounds per square inch; or
 - B. Low pressure fan nozzles with a fan angle number not larger than 80 degrees and fan nozzle orifice not smaller than 0.2 gallon per minute flow rate or equivalent, and operated at a boom pressure not to exceed 15 pounds per square inch.

Appendix B

APPENDIX B RICE PESTICIDES PROGRAM: REQUIRED HOLDING TIMES (1994 and 1997) (1994 represents the most recent program different from the 1995-97 program.)

		HOL	DING TIME	S (days)		
		SACRAMENTO VALLEY		SAN JOAQUIN VALLEY		
		Standard Hold	Water- short Areas*	Hydrolog- ically Isolated Fields	Standard Hold	Hydrolog- ically Isolated Fields
Molinate	1994	28	8	-	8	-
	1997	- 28	11	11	11	11
Thiobencarb:						
Bolero	1994	30	6	-	6	-
	1995	30	19	6	19	6
Abolish	1994	19, preflood 30, pinpoint & drill seeded	6	-	6	-
	1997	19, all applications	19	6	19	6
Carbofuran	1994	28	-	-	28	•
	1997	28	-	-	28	-
Methyl parathion	1994	24	-	-	24	-
	1997	24	-	-	24	•
Malathion	1994	4, voluntary	•	-	4, voluntary	-
	1997	4, voluntary	•	-	4, voluntary	-

^{*}Water-short areas of the Sacramento Valley include Placer County and parts of western Yolo County.

Closed systems (tailwater recovery systems) and water ponded on fallow land must meet different (shorter) holding times than indicated on this table. The program requirements for these areas are the same for the 1994 and 1997 programs.

Appendix C

Memorandum

To

: County Agricultural Commissioners from

Rice Producing Counties

Date: March 24, 1995

Place: Sacramento

Phone: (916) 324-4265

From

: Department of Pesticide Regulation - John Sanders, Branch Chief

Environmental Monitoring and Pest Managemen

Subject : Rice Pesticides Program

Follow-up on Seepage Water Management Voluntary Guidelines

The 1995 rice pesticide permit conditions were recently mailed to yo office with a cover letter dated March 20 and signed by Jim Wells. That letter referred to forthcoming information regarding voluntary guidelines for seepage water management. My staff, with input from representatives of the rice industry, county agricultural commissioners, United States Department of Agriculture (USDA), and others, developed the attached seepage water management voluntary guidelines which are meant to be reproduced and handed out when issuing permits for the use of rice pesticides. Your assistance in this matter is greatly appreciated.

Additionally, for growers interested in technical specifications on berm construction, a second handout is provided from the USDA Natural Resources Conservation Service entitled "Closed Rice Water Management Systems". This handout was developed for the California Rice Water Quality Demonstration Project to describe specifications for various closed systems, but it includes useful technical specifications for sound berm construction as well. We are supplying you with cameraready copies of this handout so your office can make good reproductions for interested growers.

Should you have any questions, please contact Nan Gorder at (916) 324-4265 or Marshall Lee at (916) 324-4269.

John S. Sande

Branch Chief

(916) 324-4100

SURNAME

convey the tail water back to an upper level rice basin. The minimum sump storage requirement shall be the volume of runoff generated by the normal flow off the bottom weir for 12 hours or 20 percent of the irrigation inflow for 12 hours, whichever is greater. The recirculating pump shall have a capacity equal to or greater than the mean inflow rate.

Static Water Systems - Systems that independently supply water to each basin within the field. Flap-gated inlet pipes or other devices keep pesticide treated water on the field and out of public water ways. It operates on the principle of a variable demand supply, only the amount of water needed to replace evapotranspiration and other losses is placed in each basin either from:

- (i) a source ditch with flashboard weirs in the ditch and flap-gated inlet pipes into each basin, or
- (ii) a pipeline or ditch with adjustable inlet float control valves into each basin.

Irrigation water in the supply ditch shall be protected from contamination by means of flap gates and other such anti-back flow devices as are appropriate. The flap gates help to keep pesticide treated field water out of the supply ditch and out of public waterways. The capacity of the static system shall be adequate to flood up the basin to the desired depth in 3 days or less.

SYSTEM OPERATION -

The owner or producer is responsible for the preparation and implementation of an operation and maintenance plan. The plan will include afficient instructions to insure that the system achieves its intended purpose.

Revised 11/94

CODA NICS Design Standards:

587 - Water Control Structures

430 - Irrigation Pipelines

388 - Field Ditches

356 - Dikes

464 - Land Leveling

206 - Rice Water Management Systems

Contact your local USDA Natural Resources Conservation Service:

Auburn	(916) 823-6830
Colusa	(916) 458-2931
Willows	(916) 934-4601
Woodland	(916) 662-2037
Yuba City	(916) 674-1461

Contact your local USDA Consolidated Farm Services Agency for cost-sharing information.

Contact your local U.C. Cooperative Extension Office or ANR Publications at (510) 642-2431 for the following publications:

Rice Irrigation Systems for Irrigation Water Management. Cooperative Extension, University of California, 1994 Pub #21490

Rice Production in California. Cooperative Extension, University of California, 1992 Pub #21498

Integrated Pest Management for Rice. Second Edition, University of California, Statewide IPM project, 1993 Pub # 3280

The USDA prohibits discrimination in its programs on the basis of race, color, national origin, sex, religion, age, disability, political beliefs, and marital or familial status (Not all prohibited bases apply to all programs). Persons with disabilities who require alternative means for communication of program information (Braille, large print, audio tape, etc.) should contact USDA's Office of Communications at (202) 720-5881 (voice) or (202) 720-7808 (TDI)).

To file a complaint, write the Secretary of Agriculture, U.S. Department of Agriculture, Washington, D.C. 20250, or call (202) 720-7327 (voice) or (202) 720-1127 (TDD). USDA is an equal opportunity employer.



Engineering Standards and Specifications for

Closed Rice Water Management Systems

California Rice Water Quality Demonstration Project

U.S. Natural Resources
Conservation Service

in cooperation with
University of California, Cooperative Extension
and the
Consolidated Farm Services Agency

SEEPAGE WATER MANAGEMENT: VOLUNTARY GUIDELINES

What is seepage?

Movement of water through a rice field levee to an adjacent area.

Why is seepage water a problem?

Seepage water can contain high concentrations of molinate, carbofuran, and potentially other chemicals as well, during the holding periods. If this water is allowed to reach agricultural drains, it could impact efforts to meet performance goals and result in toxicity to aquatic organisms.

What evidence is there to indicate seepage water contains pesticides?

Molinate was detected in rice seepage water from six out of six sites with concentrations ranging from 44 to 1300 parts per billion (ppb). Carbofuran was detected in rice seepage water collected from three out of three sites with concentrations ranging from 0.4 to 11 ppb. (Water samples were simultaneously collected from adjacent fields and carbofuran concentrations were as high or higher than in seepage water.) The current performance goal in the agricultural drains for molinate is 10 ppb and for carbofuran is 0.4 ppb.

Two demonstration sites were set up with tarps covering the seepage area to prevent molinate deposition from drift. Concentrations of molinate from these sites ranged from 37 to over 700 ppb (corrected for background concentrations).

Why are growers being asked to make voluntary efforts to control seepage water?

The Central Valley Regional Water Quality Control Board and the Department of Pesticide Regulation believe it is important that the rice growing community become aware of the potential impact of contaminated seepage water reaching the agricultural drains and have the opportunity to voluntarily address the problem. If these voluntary efforts are sufficient to minimize the impact of seepage water on the agricultural drains, no future regulatory action will be needed.

VOLUNTARY GUIDELINES

- 1. Prevent seepage water from leaving the rice field during the holding period through loosely constructed levees by
 - running a tractor tire or track on top of existing border levees, and
 - ensuring that newly constructed levees are built with mineral soils (not organic matter and plant residues), adequate width, and solid cores (when building levees, run tractor tire or track on top to firm up core of check). Double berming is another method of containing seepage.
 - using technical recommendations for levee construction offered by the USDA in a handout entitled "Closed Rice Water Management Systems," available from your county agricultural commissioner.
- 2. Prevent water in seepage areas from reaching the drains during the holding period by
 - · directing or pumping seepage water to fallow land, and
 - blocking the exit of water from the seepage ditch to agricultural drains.
- 3. Communicate with applicators to establish the common goal of keeping drift away from seepage ditches, drains, border levees, and roads. Dry material on roads and dry ground is considered to be environmental contamination with the applicator liable for a civil penalty. This material remains viable and any runoff from these areas during wet weather should be held on your property to avoid contaminating agricultural drains.
- 4. Prevent leakage from levees by inspecting and repairing rodent damage during the holding periods.

Systems

DEFINITION

A closed rice water mangement system is defined as a planned system of level basins or checks in which all necessary structures have been installed for the efficient distribution of irrigation water and containment of rice pesticides.

arthrought/MICAIL

The standards and specifications described herein refer to the following systems;

Recirculating (tail water recovery) - A flow-through system where water is applied to the upper basin and allowed to flow over weirs through a series of lower basins to a collection point where it is pumped back to an upper level basin or supply ditch for reuse.

Static (Pearson) - A system where water is independently delivered to each basin within a field via a ditch or pipeline usually along one side of the field. Water enters each basin through flap-gated inlet pipes or other antibackflow devices which keep pesticide treated field water within the basin and out of public waterways.

Selection of a specific irrigation water management system is dependent on soil type, slope, aspect (wind direction), and water delivery. No less important is the ability to hold irrigation water for the prescribed period of time necessary for the effective dissipation of pesticides. The following standards and specifications are intended to give the producer a working mowledge of system design and function. Natural desources Conservation Service should be consulted prior to actual design work or implementation.

DESIGN CRITERIA ·

All closed rice water management systems described herein are designed to contain pesticide treated water within the system for the required holding period. All drainage outlet gates and structures that can discharge water are designed such that they can be sealed during the holding period.

STANDARDS

Land Grading

- Rice only 0.02 to 0.05 feet per 100
- Rice-row crop rotation 0.05 to 0.2 feet per 100
- Basin elevation difference

not > 0.3 feet

Basin size

- Determined by maximum difference in water depth and wind.
- Where wind is a factor levees shall be closely spaced and if possible at 90 degrees to the prevailing winds. Maximum basin size is recommended at 20 acres.

Drainage

- Provisions to drain must be developed.
- Basins to be drained in a single direction no longer than 660 feet.
- Supply ditch or pipeline can serve as the drainage outlet when water control structures can be held open.
- Drainage structures shall be capable of draining basin in less than 3 days.

Dikes (Levees)

 Mineral soil only (plant residues and organic matter create seepage problems).

- Basin levees where the maximum vertical interval betw een checks is < 0.5 feet minimum top- width = 2 feet.
- Minimum sett=led height is the depth of ponding plus 0.5 feet with side slopes of 1.5 horizontal to 1 vertical.

Field perimete_r dikes (levees)

- Minimum top width of 13 feet, where access is needed, 4 feet without access. Minimum height = pond ing depth + 1.24 feet.
- Minimum side-slope of 2 horizontal to 1 vertical constructed,
- Where dikes constitute boundaries of downslope fields, and
- Where vertical intervals between basins exceed 4 feet from top to bottom basin.

Water Control Structures

Flash board weirs, float control valves, other. Capacity adequa te to meet the following:

- ◆ Irrigation flow providing a continuous flooding depth of 4 to 6 inches during stand establishment_
- Field Drainage to drain the basin within 10 days.
- Storm runoff capable of draining the runoff produced by a 10-year 24 hour storm within 2 to 3 days (1.7").

SYSTEM DESCIRIPTION WATER SUPPLY—

Recirculating (ta le water recovery) Systems are used with flow-th rough basins connected in series, where the water depth is controlled by rice boxes or other we irs placed in the levees. A storage sump or ditch is used to provide a buffer for tailwater due to variations in evapotranspira-



Appendix D

California Environmental Protection Agency
Department of Pesticide Regulation
Environmental Monitoring and Pest Management
1020 N Street, Room 161
Sacramento, California 95814
February 1997

1997 RICE PESTICIDES PROGRAM MONITORING PROTOCOL - COLUSA BASIN DRAIN

The 1997 Rice Pesticides Monitoring Program is a cooperative effort between the California Rice Industry Association (CRIA), and the Department of Pesticide Regulation (DPR). The standard operating procedures for the sampling locations, number of samples, and frequency of sampling remain unchanged from that of the 1996 program. The sampling schedule, estimated number of samples, sample collection and transportation methods, and chain of custody procedures with respect to the Colusa Basin Drain monitoring site (CBD5) only, are described below.

The monitoring program will begin with background sampling two to three weeks prior to the first applications of carbofuran in the region (usually early to mid-April). These samples will be collected by DPR and CRIA consultant personnel with a review of procedures for the season on the same day (all personnel attending). Surface water sampling and water quality measurements will be performed twice weekly, by a CRIA consultant, for a period of ten weeks following initial field flooding. The anticipated sampling schedule is presented in Table 1. The total number of samples for CBD5 only is estimated in Table 2.

Table 1. Sampling schedule for the 1997 Rice Pesticides Monitoring Program

DATE

SITE (CBD5)

Background (2 to 3 weeks prior)	<u>Day 1</u> I ² + toxicity + quality control set	<u>Day 2</u> Not sampled
Week 1	Пр	Ш°
2	П	Ш
3	П	Ш
4	П	Ш
5	П	Ш
6	Π	Ш
7	п	Ш
8	I	Ш
9	I	III
10	I	m

a) Schedule I: molinate, thiobencarb, carbofuran, methyl parathion and malathion.

b) Schedule II: molinate, thiobencarb, carbofuran, methyl parathion and malathion + toxicity.

c) Schedule III: schedule I + quality control set for most chemicals.

Table 2. Estimated number of primary samples from CBD5 for the 1997 Rice Pesticides Monitoring Program

DATE	MOLINATE	THIOBENCARB	CARBOFURAN	METHYL PARATHION & MALATHION	TOXICITY
Background	2(1)	2(1)	2(1)	2	1
Week 1	3 (1)‡	3 (1)	3 (1)	3	1
2	3 (1)	3 (1)	3 (1)	3	1
3	3 (1)	3 (1)	3 (1)	3	1
4	3(1)	3(1)	3 (1)	3	1
5	3(1)	3 (1)	3 (1)	3	1
6	3 (1)	3 (1)	3 (1)	3	1
7	3 (1)	3(1)	3(1)	3	i
8	3 (1)	3 (1)	3(1)	3	0
9	3(1)	3 (1)	3 (1)	3	0
10	3 (1)	3 (1)	3 (1)	3	0
TOTALS	32 (11)	32 (11)	32 (11)	32	8

^{†)} Methyl parathion and malathion are analyzed from a single sample.

^{‡)} Numbers in parentheses indicate the number of samples taken for quality control under schedule III.

Total Chemical Analyses	(Primary analyses)	=	128 samples
Toxicity	(1 sample/wk x 8 wks)	=	8 samples
	Primary Sample Total	=	136 samples

Sampling Methods

Excluding the background samples, all sampling for the 1997 season will be performed by a CRIA consultant. As standard operating procedure, all sampling personnel will wear rubber gloves during sampling and if contamination is suspected, the gloves will be replaced. Every attempt will be made to avoid both disturbing the bottom of the agricultural drain and sampling areas of the drain with no observable flow. All bottles and chain of custody records (COCs) will be provided by DPR.

Samples will be collected using a Kemmerer water sampler (stainless steel and Teflon® model) at a depth equal to one-half the water column. The Kemmerer has a capacity of 1.5 liters, and a composite sample consisting of the appropriate number of sub-samples are to be deposited in a stainless steel container provided by DPR. The volume of water collected is determined by the sampling schedule number (Attachment 1). The composite sample will then be homogenized and split into 1-liter amber bottles with Geotech water splitter provided by DPR. A COC will accompany each sample bottle. Samples will then

APPENDIX D

be stored on wet or blue ice (4°C). All sampling equipment is to be cleaned immediately after sampling.

Samples to be analyzed for carbofuran and methyl parathion/malathion will be acidified with 3N HCl to a pH between 3.0 and 3.5 for increased sample stability during storage. All samples will be stored on wet or blue ice (4°C) until delivered to the laboratory for analyses. The toxicity samples and backups will be collected as part of the primary volume of water. Backup samples will be collected and held in storage (4°C) until the initial data analyses are complete.

Rinse blanks for each monitoring site will be prepared by pouring 4.5 liters of deionized water over the cleaned sampling equipment and collecting the resultant rinse water. The rinse water is then to be transferred to four 1-liter amber bottles and submitted for analyses with the primary samples. This process will occur in weeks three, six, and nine for a total of three samples per target chemical.

Water temperature, pH, and dissolved oxygen will be measured at each monitoring site during all sampling periods and the data recorded on the water quality sheet provided by DPR (Attachment 2).

Sample Delivery

Samples are to be delivered to DPR's West Sacramento facility after each monitoring event. Schedule II event samples (toxicity only) will be delivered by the CRIA consultant to CDFG's Aquatic Toxicology Laboratory (ATL) in Elk Grove by 3:00 p.m. (earlier if possible) on Tuesday of each week.

Appendix E

43 - 4 - 13 - 1 1

STATE OF CALIFORNIA DEPARTMENT OF FISH AND GAME

AQUATIC TOXICOLOGY LABORATORY REPORT

9300 Elk Grove-Florin Road Elk Grove, CA 95624

Lab No	P-1873	Sample:
-	· .	03/18/97 04/01/97
	:	04/22/97 04/29/97
	•	05/06/97 05/13/97
		05/20/97 05/27/97
		06/03/97
E.P. No		
To:	Brian Finlayson, ES IV	Report Date: 06/13/97
Address:	California Department of Fish and Game	
	Pesticide Investigation Unit	
	Rancho Cordova CA 95670	

Remarks:

Water samples were collected by Department of Pesticide Regulation (DPR) staff from April 1 - June 3, 1997 during a routine pesticide and toxicity monitoring study. Samples were analyzed for pesticides by DPR staff. Water quality and acute toxicity were determined by Aquatic Toxicology Laboratory (ATL) staff. The control water was ATL well water. Static toxicity tests (96-h) with 48-h renewal of undiluted water samples were performed using the cladocerans Certodaphnia dubia.

RESULTS OF EXAMINATION Water Quality Parameters

Water samples were analyzed for specific conductivity, total alkalinity, total hardness and total ammonia (Table 1). The water quality data did not indicate any specific condition considered deleterious to the test organism.

Toxicity Test Results

None of the undiluted samples from Colusa Basin Drain showed statistically significant mortality in the C. dubia tests (Table 1), except the blind spiked samples. Blind blanks S052097-1 (#161-0801) and S052097-2 (#161-0802) induced no mortality but blanks S052097-3 (#161-0803) and S052097-4 (161-0804) caused 100% mortality. Survival in the control water was above 90% in all successful tests.

Table 1. Water quality and acute toxicity of undiluted sample to the cladoceran Ceriodaphnia dubia.

		Percent Survival			Water Ouality'		
Sample Number	Sample Type	Control Water	UndilutedSample	Alkalinity	Hardness	Conductivity	Ammonia
S030497-7	Water	100	100	12	10	37	<0.050
s033197-1	Water	90	100	195	196	602	0.135
S042297-1	Water	100	100	132	124	470	0.053
S042997-1	Water	100	100 😭	154	142 :	563	0.052
s050696 - 1	Water	100	100 (77)	-1.27	132	553 **	0.057
S051396-1	Water	100	100	-1 :162	186	542	0.085
S0S2097-1	Water	100	95	11	14	36	<0.050
s052097-2	Water ^b	90	95	13	12	36	<0.050
S052097-3	Water ^b	90	0*	11	10	35	<0.050
S052097-4	Water ^b .	90	0*	11	10	36	<0.050
s052097-5	Water	100	100	160	164	610	0.089
so52797-1	Water	100	100°	158	148	474	<0.050
S060396-1	Water	100	90	200	208	756	0.052
		100	90(duplica	te test)			

Total alkalinity and total hardness reported in mg/L CaCO; specific conductivity reported in µS/cm; and total ammonia reported in mg/L N.

b Blind blank

^{*} Survival significantly less than the control group (P < 0.05).

PESTICIDE INVESTIGATIONS UNIT ENVIRONMENTAL SERVICES DIVISION

Βv

Charlie Huang, Ph.D. Environmental Specialist

cc:

John Sanders

Department of Pesticide Regulation

Sacramento, California

Huang:CH

File: C. Huang, ATL; PIU Chron

Appendix F

CALIFORNIA DEPARTMENT OF PESTICIDE REGULATION Environmental Hazards Assessment Program

Laboratory Project Plan and Protocol for the 1997 Rice Pesticides Monitoring Program Study #161 February 1997

Organization and Responsibility

KayLynn Newhart is assigned Environmental Hazards Assessment Program (EHAP) laboratory liaison for the Department of Pesticide Regulation. Her duties include: Reviews laboratory QA/QC plans and QA reports; meets or communicates with field sampling consultant and sample custodian to evaluate progress and resolves problems; submits QA reports to Nan Gorder.

Nan Gorder is the agency contact person and project leader for the rice pesticides program for the Department of Pesticide Regulation. Her duties include the overall responsibility of agency communications and project changes concerning this monitoring project.

All laboratories should report all analytical data and information to KayLynn Newhart.

Protocol

The monitoring program shall follow the approved written EHAP protocol (Appendix 2). Changes to the protocol must be approved by the EHAP.

Quality Assurance Objectives

Each laboratory will use their method detection limit (MDL), instrument detection limit (IDL) and a reporting limit (RL) for each analyte as documented in their approved 1995 analytical method.

Method Validation

The mean and standard deviation (s) values from the 1995 method validation study will be used to set warning and control limits at +\-2s and +\-3s, respectively. Each laboratory will be required to notify the EHAP laboratory liaison of any changes or procedures made to the 1995 analytical method before analyzing any field samples.

Continuing Quality Control

Accuracy is defined as a determination of how close the measurement is to the true value and is often described as <u>percent recovery</u>. Accuracy is to be expressed as Percent Recovery (%). All calculated values for accuracy shall be presented with the analytical results. The equation for calculating Percent Recovery is as follows:

sample concentration

Percent Recovery (%) = X 100

matrix spike concentration

Accuracy will be assessed by requiring each laboratory to analyze two matrix spike samples per analyte for each extraction set of up to twelve field samples (Appendix 1).

Accuracy control charts will be plotted by EHAP for each chemical and method and for each control sample matrix. The warning and control limits are established as listed in the method validation section. If any continuing quality control spike recovery is not within the limits of these criteria, the following is required:

- 1. A check shall be made to be sure there are no errors in calculations, surrogate solutions, and internal standards. A check shall also be made on instrument performance.
- 2. All affected data shall be recalculated and/or the extract shall be reanalyzed if any of the above checks reveals a problem.
- 3. All affected samples shall be re-extracted and reanalyzed if none of the above is identified as a problem.
- 4. All analytical data shall be flagged as "suspect" if the accuracy still does not fall within the limits of the above criteria. The laboratory QA officer shall notify the EHAP QA officer within one working day after discovery of "suspect" data.
- 5. If an unacceptable value cannot be corrected, additional samples may be analyzed to determine the validity of the original sample results.

The calibration curve should be prepared such that one standard is at the reporting limit and one is higher than the highest expected amount. If after initially shooting the sample extract the concentration of the analyte falls outside the calibration range, the sample should be diluted so it falls within the calibration range. Each laboratory shall notify the EHAP laboratory liaison of any changes in their 1995 calibration procedures. As an interlaboratory quality control check a minimum of ten percent of the total samples collected may be analyzed by a second laboratory for verification. CDFA laboratory will analyze split samples for molinate, thiobencarb and carbofuran.

In addition, three rinse blank samples will be collected from CBD5 during weeks 3, 6, and 10 to check for potential field contamination. Blind matrix samples will be routinely submitted to each laboratory to check for accuracy.

Background surface water will be provided by EHAP to the laboratories and used for control and fortification samples.

Backup field samples collected and stored during the study may be analyzed if sample breakage occurs or if sample results between the primary and quality control laboratories are dissimilar.

Audits of the field sampling and lab analyses may be conducted.

Reporting

Results of field sample and continuing quality control analyses shall be reported to the EHAP laboratory liaison within 21 days of the date samples are received at each laboratory. Each laboratory shall submit legible, organized reports which contain analytical results of all samples received from EHAP. Analytical results are to be expressed as ug/L to three significant figures for all samples. Positive matrix blank results shall be reported. Do not correct field sample results for background levels. Indicate if the results have been adjusted for spike recoveries. Each laboratory shall notify the EHAP laboratory liaison of any changes in their 1995 procedures for reporting sample results including number rounding procedures. The report shall evaluate the quality of the individual sample data, based on the method validation analyses. The reports shall include the following:

- 1. Chain of custody (COC) forms; all analytical results are to be reported on the COC, including the name of the person extracting and analyzing the sample, date of extraction and the date of analysis for each sample
- 2. Records of any quality assurance problems and questions pertaining to the samples analyzed
- 3. Calculations of accuracy
- 4. Reporting Limit (RL); for those samples that contain no detectable amount, write "ND" and indicate the RL
- 5. Case narrative, if the data requires it

In addition, the laboratory shall be prepared to provide to the EHAP lab liaison all sample custody paperwork, records of times and dates of analyses, and raw data pertaining to both the analyses and the quality control checks within 10 working days after the information is requested.

Archives

All backup samples and sample extracts shall be stored frozen or refrigerated until EHAP authorizes their disposal.

All raw data, including chromatograms, memoranda, notes, worksheets, and calculations that are necessary for the reconstruction and evaluation of the study shall be archived at each respective laboratory for at least three years.

1997 Rice Pesticide Continuing Quality Control Procedures

Using background surface water, each laboratory will generate and analyze the following blank matrix and matrix spikes with each extraction set in order to determine accuracy over the duration of the study. All continuing quality control data will be submitted to the EHAP laboratory liaison with each extraction set. Make sure individual field sample numbers are clearly identified with each set.

Methyl Parathion and Malathion

•	CDFA	
1 blank and 2 matrix spikes	0.2 ppb	
Molinate	Zeneca	<u>CDFA</u>
1 blank and 2 matrix spikes	5.0 ppb	5.0 ppb
Thiobencarb	Valent	CDFA
1 blank and 2 matrix spikes	1.0 ppb	1.0 ppb
Carbofuran	<u>FMC</u>	CDFA
1 blank and 2 matrix spikes	1.0 ppb	0.5 ppb

RICE PESTICIDES MONITORING 1997

Water Sample Schedules

SCEDULE I (molinate, thiobencarb, carbofuran, methyl parathion, malathion) 9 liters total

Site: CBD5

Dates: June 10, 24

Sites: SR1, BS

Dates: April 22, 29 May 6, 8, 13, 15, 20, 22, 27, 29 June 3, 5, 10, 12, 17, 24

Primaries

- 1) molinate (ME)
- 2) thiobencarb (TB)
- 3) carbofuran (CN)
- 4) methyl parathion/malathion (MP/MN)

Backups

- 5) acidified (BA1)
- 6) acidified (BA2)
- 7) unacidified (BU1)
- 8) unacidified (BU2)
- 9) water quality

SCHEDULE II (molinate, thiobencarb, carbofuran, methyl parathion, malathion + toxicity)

10 liters total

Sampling Site: CBD5

Dates: April 22, 29 May 6, 13, 20 June 3

Primaries

- 1) molinate (ME)
- 2) thiobencarb (TB)
- 3) carbofuran (CN)
- 4) methyl parathion/malathion (MP/MN)

Backups

- 5) acidified (BA1)
- 6) acidified (BA2)
- 7) unacidified (BU1)
- 8) water quality
- 9) Toxicity (2, 1-liter amber bottles)

SCHEDULE III-QUALITY CONTROL (molinate, thiobencarb, carbofuran, methyl parathion, malathion)

11 liters total

Sampling Site: CBD5

Date: April 24 May 1, 15, 22, 29 June 5, 12, 19, 26

Primaries

- 1) molinate (ME)
- 2) thiobencarb (TB)
- 3) carbofuran (CN)
- 4) methyl parathion/malathion (MP/MN)

Quality Control

- 5) molinate/thiobencarb (ME/TBX)
- 6) carbofuran (CNX)
- 7) methyl parathion/malathion (MP/MNX)

Backups

- 8) acidified (BA1)
- 9) acidified (BA2)
- 10) unacidified (BU1)
- 11) water quality

Appendix 2

SCHEDULE IV-QUALITY CONTROL, RINSE BLANK (molinate, thiobencarb, carbofuran, methyl parathion, malathion)

16 liters total

Site: CBD5
Date: May 8

Primaries

- 1) molinate (ME)
- 2) thiobencarb (TB)
- 3) carbofuran (CN)
- 4) methyl parathion/malathion (MP/MN)

Quality Control

- 5) molinate/thiobencarb (ME/TBX)
- 6) carbofuran (CNX)
- 7) methyl parathion/malathion (MP/MNX)

Backups

- 8) acidified (BA1)
- 9) acidified (BA2)
- 10) unacidified (BU1)
- 11) unacidified (BU2)
- 12) water quality

Rinse Blanks

- 13) molinate (ME)
- 14) thiobencarb (TB)
- 15) carbofuran (CN)
- 16) methyl parathion/malathion (MP/MN)

Appendix 2

SCHEDULE V Rinse Blanks and Toxicity (molinate, thiobencarb, carbofuran, methyl parathion, malathion)

15 liters total

Sampling Site: CBD5

May 27

Primaries

- 1) molinate (ME)
- 2) thiobencarb (TB)
- 3) carbofuran (CN)
- 4) methyl parathion/malathion (MP/MN)

Backups

- 5) acidified (BA1)
- 6) acidified (BA2)
- 7) unacidified (BU1)
- 8) unacidified (BU2)
- 9) water quality
- 10) toxicity (2 liters)

Rinse Blanks

- 11) molinate (ME)
- 12) thiobencarb (TB)
- 13) carbofuran (CN)
- 14) methyl parathion/malathion (MP/MN)

Appendix 2

SCHEDULE VI-RINSE BLANK (molinate, thiobencarb, carbofuran, methyl parathion, malathion)

13 liters total

Sampling Site: CBD5

Dates: June 17

Primaries

- 1) molinate (ME)
- 2) thiobencarb (TB)
- 3) carbofuran (CN)
- 4) methyl parathion/malathion (MP/MN)

Backups

- 5) acidified (BA1)
- 6) acidified (BA2)
- 7) unacidified (BU1)
- 8) unacidified (BU2)
- 9) water quality

Rinse Blanks

- 10) molinate (ME)
- 11) thiobencarb (TB)
- 12) carbofuran (CN)
- 13)methyl parathion/malathion (MP/MN)

Appendix G

EMERGENCY RELEASE

Grower: Aus Permit No.: 57-97-57	0633A
Address: 407 Les Rolles Zip: 25695	. 4 - 100
Field location: 1. mi. 7. 1-5-Bylass. Site No.: 7). +/. / (Attach detailed map)	
Chemical applied: Cracum Soular Chemical applied:	
hate of application: '30 kg. Rate of application:	
Date of application: 5 - 27 - 97 Date of application:	
Average water depth at Average water depth at	
time of application: 611 time of application:	
Chaminal analised. I am of a company to the second and the company to the company	
Chemical applied: Londay Chemical applied:	
Rate of application: 1,6 02 Rate of application:	 ,
Date of application: 5-27-97 Date of application:	
Average water depth at Average water depth at	•
time of application: 64 time of application:	
Starting date of emrgency release: 6-3-97	, , , , , , , , , , , , , , , , , , ,
Acres in field: 1507 Laser leved? Yes 🗆 N	10 🖾
Type of irrigation system: Flow through -Racycle - Static - Other	er 🗖
Date flooding began: No. of days it takes to fill field:	
Describe problem that led to emergency release: High Wife	
- Mesa yellow - France - Leasen for chap	
water - 12 alie grantle 4-6"	
Steps that can be taken to prevent emergency releases from this field in future ye	ears: 🖁
	2
Recommendation (attached) by: 18 (C.C.,	
Application by:	
George de la company de la com	Time Marian.

EM	ERG	EN	CY	REL	EA	SE

Grower: Arisenethine Permit No.: 570633A

Address: 407 For Roller Zip: 0.569.5

Field location: 1. Smi. N. 1-5- By Pass Site No.: D. H. 1

Beginning date of release: 6-3-97 Ending date: 6-6-97

The grower must determine the amount of water discharged during the emergency release period. To do this, measure the width of each weir opened to allow the discharge. Then, on a daily basis, measure the height of water flowing oever each weir. Record all information in the table below.

W	Weir 1		eir 2	Weir 3		
Width: 3	מ"	Width:		Width: .		
Date	Height of water	Date	Height of water	Date	Height of water	
6-3-87	20"	-,4		<u> </u>	(7)	
6-4-97	2.5"	t War		<u> </u>		
6-5-97	10x	3		***		
				ost."		
: 						
	34 J. P. J.			# 1 1 (1)	<u> </u>	
. X (
	:					

	·		- 1	÷		
				•		

U CU MUZWIT MELL. TEE 140.330-004-01

EMERGENCY RELEASE
Grower: DOERING FALMS - BEALL Permit No.: 57-97-3400519
Address: 1418 NORDEN WY WOODLAND 95695 Zip:
Field location: Conaway RCH 27-IN Site No.: 27-I
Chemical applied: CRDRAM Chemical applied:
Rate of application: 25 * Rate of application:
Date of application: MAY 20 Date of application:
Average water depth at Average water depth at
Average water depth at time of application: Average water depth at time of application:
A BALL CART OF THE PROPERTY OF THE PARTY OF
Chemical applied: LONDAX Chemical applied:
Rate of application: 1.6 = Rate of application:
Date of application: Date of application:
Average water depth at Average water depth at
time of application: time of application:
Starting date of emrgency release: 6-1-97
Acres in field: 270 Laser leved? Yes 🖾 No 🗆
Type of irrigation system: Flow through Recycle Static Other
Date flooding began: No. of days it takes to fill field:
Describe problem that led to emergency release: HIGH WATER PLUS
MIDGE IN FIELD NEED TO RESEED FIELD
Steps that can be taken to prevent emergency releases from this field in future years:
Recommendation (attached) by: JOHN! TAYLOR DIXON TON VAN BROCKLI
Application by: GROWERS AIR
Grower's signature: (PCA) Tom Un Righti Date: 6-2-97
Approvedby:
/ Agricultural Biologist

TENCER CO DEL TOT HO			1101 2		148.00	
DOWN TAYLOM FERTILIZERS OR RIEGELS CHEMICALS OR & S FARM SUPPLY	ORLAND FERTILIZ OCHRISTIAN & HUR		(F	EST CONTRO		
() GROWER	acus s			DATE 5/	/	11250 _ <u>ッ</u> ケフ
DRESS.	CITY, 6					
COUNTY PERMIT NO 2/-92-3/	1087 AD CROS	Rice		<u> </u>	ACRES	181
① LOCATION OF FIELD	8 5 11). Not	1 Su	wet &	Mila	- / 100
West of Rower &			0			
LOCATION OF DELIVERY						
DATE TO BE DELIVERED	19 AP(NOTIFIED	my letais
③ PEST(S) TO BE CONTROLLED	1/5/10				KIN	STORE
APPLICATION DATE	TIME	AM/PM	EXPIRA	TION DATE:		
1 FIELD POSTING REQUIREMENTS	① DAYS BE	FORE HARVEST		1 RE-ENTRY	NTERVAL	
INFO TO SHOW ON INVOICE			① CR	OP ROTATION R	ESTRICTION	
1 MATERIAL AND REGISTRATION NUM	BER WINE TO	DRATE/ACRE (OILUTION RATE	1 VOLJACRE	SIZE	TOTAL
PI	海交级	1 5 . 3		17 17 11	to a feet to	7.0F
- Completely Vertex	一 没进到			D _A ·		17
el Water for	。即長身	•			1 -	7.11
						110
Control at Alcae			· · · · · · · · · · · · · · · · · · ·			
				·		
			.v	7		
		:				
• • • • • • • • • • • • • • • • • • • •		<u> </u>		1 ~.		
REMARKS: (HAZARDS AND/OR RESTRICTIO	ONS, ETC.)	(A) CRITERIA	USED FOR DETE	RMINING NEED F	OR RECOM	MENDATION
1 Highly toxic to bees			ep net counts		□ 5 Ph	erome'or her traps
 2 Toxic to birds, fish or wildlife 3 To not apply when irrigating or run-off is f 	ikely to occur	☐ 2 Leai	or fruit counts	4 Field observati	on 6 So	il sampling
4 Do not allow drift to sorghum	TRATE TO BEED!	**,** **				
5 Cutoff date applies (see label) 6 Do not irrigate for at least 5 days after appl	liention	71	Property .	is Recisi	fried ,	for
7 Do not plant crops other than corn or mile		118	: KCO	- Grown	0 1/1	Desire
8 Do not irigate for at least 10 days after app		111	10	CASIDA .	- autor	VIAID .
 9 Do not apply not susceptible or desirable; 10 Do not allow to drift onto humans, susceptible. 		fieldo	and Tro	sewil your	teak of	Hobil
plants or animals		Require	inc Wat	in Holds	There	are
11 Keep out of lakes, ponds or strooms 12 Do not apply when wind it over	MPH	and the	A Re	made line	Messes	1.70
13 Birth fending on treated area may be killed	,		1/	"	7 .1.20	· · ·
14 Do not apply more than once per season		preven!	pr gas			······································
15 Do not apply more than once per custing 16 Do not use on corn seed stock			Y THAT THIS RECOMM			
17 Do not apply when foliage, bank or branche	es are wet Idew, rain, etc.)	MIXING OR APPLY	WE ARE NOT RESPON NG, OR APPI ICATION	NOT IN ACCORDANCE	WITH THIS REC	COMMENDATION,
18 Do not feed treated follage or straw to lives		IMPHOPER CULTUR	ns or any local or al practices, applic	ATION UNDER ADVER	ef McVinch Co	NUITIONS OH TC
 □ 19 Do not plant small grains, grasses or onions □ 20 Do not plant milo, corn, beets, root crops o 		OUR CONTROL	DHIFT DAMAGE TO NE	IGHBORING FIELDS, D	H ANY OTHER FA	(C) DHE BLYOND
21 May cause allergic reaction to some people						1
 22 Do not apply when temperatures are below during or shortly after application 	40° F or aboveF		TION OF ALIEHN alternatives and n		 a thai would	substantially
23 Do not apply when plants are stressed do to moisture or rapid change in temperature	wind, drought,	•	ignificant adverse	•		
24 Crop rotation note (see label for details)	numata unas stato sono escada.	sidered and,	if leasible were a	dopl e d.	.*	. *
'S This product is corrosive to or reacts with co _6 Closed system required	errain materials (see label)		11-61	4/21/23		
27 Restricted use Pesticide (EPA)		ADVISOR'S SIGNA	TURE		· , ·-	-
28 Requirement to hold water (see label) 29 Hazardous Area involved		P) B	1/089	. د. د. رسمه مرک	1 5	SO
		ADDRESS. CITY	<u> </u>	Chacama	-10, 73	<u> </u>

Field 10 - water Wair 2 Field 8 on: P.CA Sunset Blud West

ATTACHMENT 7

EMERGENCY RELEASE

Grower:	Permit No.: 31-97-311087A
Address: P. O Bo x 724	Zip: 95668
Field location: N Sunset Blud West 5	W/Brewer RI Site No.: 8 + 10
Beginning date of release: 5-15-97	Ending date:

The grower must determine the amount of water discharged during the emergency release period.

To do this, measure the width of each weir opened to allow the discharge. Then, on a daily basis, measure the height of water flowing over each weir. Record all information in the table below.

Field 8 Weir.1 Width: 111"		Field 10 Weir 2 Width: 14"		Weir 3 Width:	
7000	aton	45 46	atan	 	
-	2 in depth		2 in dept	6	
11.6 40	1		ffof		
water		watel			. •
, , , , , , , , , , , , , , , , , , , ,	= 11.60af+		12 = 7.5 pere	10	
		,		41.	1.25.
		::		1 3 4	· ·
	· .				
		-			<u> </u>
	 	.	<u> </u>		
		<u>.</u>			

TOBO

Poles file

ATTACHMENT 6

EMERGENCY RELEASE

	Grower: Jeff Vost	Permit No.: 31-97-311087A
	Address: P.U. Box 724	Zip: 95668
	Field location: N/Sunset ,5mi W/	Blewel Rd Site No.: 8+10
	(Attach detailed map)	
	Chemical applied: Oradram	Chemical applied: Furada a
	Rate of application: 26.5/65	Rate of application: 10 1 h.t. oct acc. ca 20.
Field 8	Date of application: May 6	Rate of application: 10 163 per acre en 20. Date of application: 4-23-97
	Average water depth 3"	Average water depth: div field when the
	at time of application:	at time of application:
	Chemical applied: Oradian Londar	Chemical applied: Fura Jan
	Rate of application: 26.5 lbs 1.6 125	Rate of application: 10 165 per acre on 20ac
Field 10	Date of application: May 6	Date of application:
7010-1-	Average water depth '3"	Average water depth dry field when
	at time of application:	at time of application: In ear occa to d
	Starting date of emergency release: 5-15	
	Acres in field: Field 8 70 Ac Field 10 45as	cr leveled? Yes No
	Type of irrigation system: Flow through	RecycleStaticOther
	Date flooding began: 4-23-97 No. of c	lays it takes to fill field:
	Describe problem that led to emergency release:	The field was over to ken
	by Black Algae within Ze	14/3
	Čana dan na haidi.	Constitution of the second
	Steps that can be taken to prevent emergency relea	
	which is required Air Resource	of incorporating the straw
		Juha Taylor Fertiliza
	Recommendation (attached) by: Dave 5://s	JUNA 12, 101 PEF4.1. 2.
	Applications by:	
•	Grower's signature: _ Geffrey Dung	Date: June 1, 1997)
	Approved by: Knith ten	
	Agri	cultural Biologist